

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM
FOR NOVEMBER 2013**

44301 2013 Escape, Fusion, Edge, Explorer, Taurus, MKT, MKZ With 6F35 Transmission -
Fluid Leak - Seal - Left Side Half Shaft

Some 2013 Escape, Fusion, Edge, Explorer, Taurus, MKT, MKZ vehicles equipped with a 6F35 automatic transmission may exhibit a fluid leak from the left hand (LH) half shaft seal due to wear on the case bushing . A new designed case bushing with a red Teflon coating on the ID (inside diameter) of the bushing is available. Order a Teflon coated bushing (DV6Z-7025-C) along with the LH halfshaft and seal. To replace the bushing in the transaxle case and LH halfshaft seal, Refer to WSM, Section 307-01. Place a small amount of Loctite 648 on only the outside of the entire outer circumference of the new red Teflon coated bushing before installation.