

**ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR NOVEMBER 2013**

44300 2009-2012 Escape, 2009-2011 Mariner, 2010-2012 Fusion and 2010-2011 Milan - 6F35  
Transmission - Fluid Leak - Seal - Left Side Halfshaft

Some 2009-2012 Escape, 2009-2011 Mariner, 2010-2012 Fusion and 2010-2011 Milan vehicles equipped with a 6F35 transmission may exhibit a fluid leak from the left hand (LH) halfshaft seal due to wear on the case bushing. A new designed case bushing with a red Teflon coating on the (ID) inside diameter of the bushing is available. Order a Teflon coated bushing (DV6Z-7025-C) along with the service kit to address this leak. Discard the bushing with the silver colored aluminum coated on the ID that is included with the kit. To replace the bushing in the transaxle case and LH halfshaft seal, Refer to WSM, Section 307-01. Place a small amount of Loctite 648 on only the outside of the entire outer circumference of the new red Teflon coated bushing before installation.