

SB-10055591-7394

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR FEBRUARY 2014

44394 2011-2014 F-Super Duty - Trac Control Lamp Flashing - Diagnostic Trouble Code (DTC)C0062:62 Longitudinal Acceleration Sensor - Built On Or Before 11/18/2013

Some 2011-2014 F-Super Duty vehicles built on or before 11/18/2013 may exhibit a condition where the traction control indicator is flashing/illuminated with DTC C0062:62 Longitudinal Acceleration Sensor stored in the anti-lock brake system (ABS) module. A Hill Descent Control or Advance Trac error message may intermittently appear over undulating road surfaces. If DTC C0062:62 is with other DTC's this message is not applicable, refer to updated Work Shop Manual (WSM) section 206-09 for diagnostics and testing. If only DTC code C0062:62 is set alone in ABS module, with no other DTC's replace the ABS (Base 2C219) Module. Refer to WSM section 206-09 and use service labor times standards (SLTS) operations. All service stock of ABS modules is clean. Refer to DOES II or Ford Catalog for the latest and greatest service part availability.