

Engine has no output

Topic number	LI09.10-P-059184
Version	1
Design group	09.10 Air cleaner
Date	06-16-2014
Validity	222.177/178 up to VIN #A 023218
Reason for change	
Reason for block	

Complaint:

Engine has no output

Cause:

Right air intake is loose in the area of radiator shroud

Remedy:

Affix right air intake (Figure 1, item A) at a lower locking point on the shroud (Figure 1, item B) using bracket (Figure 2, item C).

Attachments	
File	Description
Abbildung 1.JPG	Figure 1
Abbildung 2.JPG	Figure 2

Symptoms
Power generation / Engine management / Engine performance / Goes into limp-home mode
Power generation / Engine management / Engine performance / Poor/delayed throttle response
Power generation / Engine management / Engine performance / No/poor output
Power generation / Engine management / Engine performance / Poor acceleration

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 222 504 00 00			Bracket	1		X	

Work units

XENTRY

Op. no.	Operation text	Time	Damage code	Note
			09122 38	ENGINE AIR INTAKE HOSE IS LOOSE
09-8200	ENGINE INTAKE AIR DUCT UPSTREAM OF AIR FILTER			
54-1011	SHORT TEST			
54-0650	BATTERY CHARGER / VOLTAGE MAINTAIN			

Validity			
Vehicle	Engine	Transmission	
222.177	157.985	*	
222.178	157.985	*	

Full model designation breakdown			
Vehicle	Engine	Transmission	
222.177	157.985	722.931	
222.178	157.985	722.971	

Attachments

Abbildung 1.JPG:

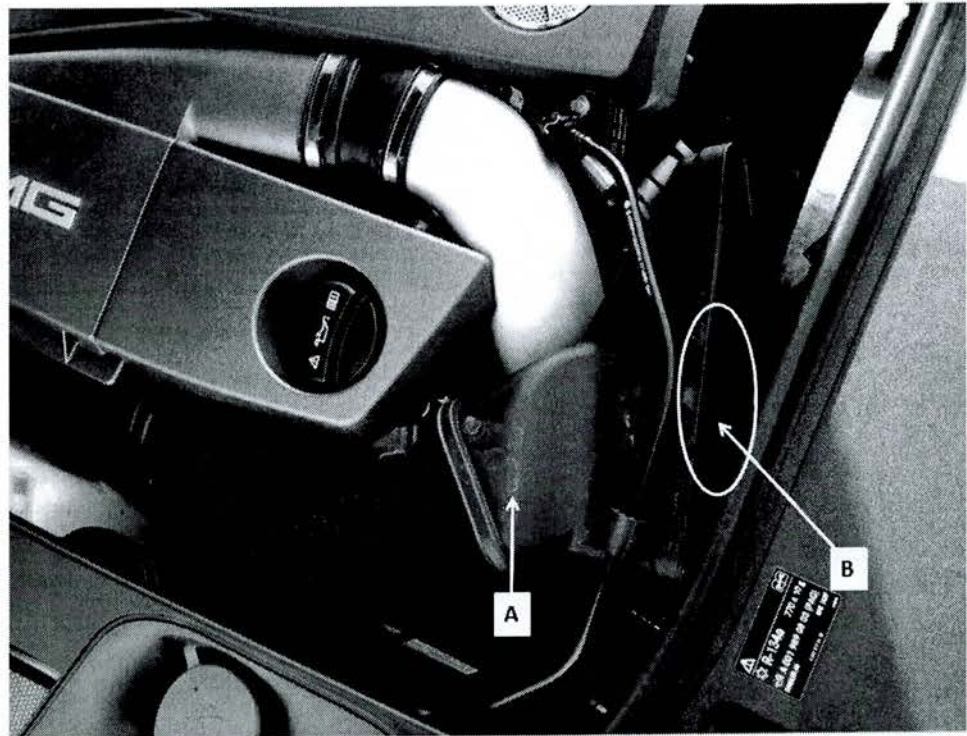


Abbildung 2.JPG:

