


INTRODUCTION

This bulletin announces availability of a revised replacement air intake duct for the turbocharged vehicles specified above. If the insulator portion of the duct begins to separate from the duct and leak boost pressure, increased sound levels and a loss of power can result. The revised air intake duct has the insulator portions glued in place to prevent their separation.

PART INFORMATION

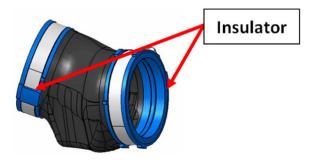

APPLICABILITY	MODEL YEAR	PART NAME	NEW PART NUMBER	
Legacy and Outback	2010-12	DUCT ASSY	14459AA740	
	2005-09			
Forester	2009-13	AIR INT	14459AA750	
Impreza WRX	2008-14			

SERVICE PROCEDURE / INFORMATION

Follow the procedure outlined in the applicable Service Manual for replacement of the intake air duct.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited Warranty period, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR Time
INTERCOOLER ASSEMBLY, R&R	A227-301	DCM-48	0.3

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

SUBARU OF AMERICA, INC. IS "ISO 14001 COMPLIANT"

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

The international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.