

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM  
FOR SEPTEMBER 2014

**SB-10057742-3657**

44742

2013-2014 Fusion, MKZ, And 2015 MKC - Unable To Perform a Programmable Module installation (PMI) On A Replacement Instrument Panel Cluster (IPC)

Some 2013-2014 Fusion, MKZ, and 2015 MKC may exhibit an IPC that will not complete a PMI during IPC replacement if the IDS software level is at 92.01 or 92.02. To correct this concern, uninstall IDS and re-install IDS version 91.01 using the following address: [http://www.fordservicecontent.com/Ford\\_Content/IDS/IDS-91.01\\_Full.exe](http://www.fordservicecontent.com/Ford_Content/IDS/IDS-91.01_Full.exe) This concern will be corrected once IDS version 92.03 is released, which is currently scheduled for October 1st of 2014. Once the PMI has been completed update the IDS back to the latest level.