

SB-10057865-6196

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR SEPTEMBER 2014

44707 2009-2015 Vehicles Exhibiting Diagnostic Trouble Code (DTC) P06B8, P068A And/Or P2610 After Powertrain Control Module Reprogramming

Some 2009-2015 Model Year vehicles may exhibit a Malfunction Indicator Lamp(MIL) On with Diagnostic Trouble Codes P06B8(Internal Control Module Non-Volatile Random Access Memory (NVRAM) Error), P068A(ECM/PCM Power Relay De-Energized - Too Early) Or P2610(ECM/PCM Engine Off Timer Performance) after Powertrain Control Module reprogramming. These DTCs can set during PCM programing if the key is not left in the off position for 30 seconds following PCM programing before clearing DTCs. If these DTCs are present following PCM reprogramming, clear the Diagnostic Trouble Codes from the PCM and retest. Do not replace the Powertrain Control Module. If any DTC reoccurs refer to the Powertrain Control/Emissions Diagnosis (PC/ED) manual to diagnose the concern. Monitor OASIS for future updates.