

SB-10058434-7209

ONLINE AUTOMOTIVE SERVICE INFORMATION FOR MAY 2015

45090 2013-2016 Fusion/MKZ, 2013-2015 C-Max, 2015 F-150/MKC - P062C Sets After Module Programming - Cycle Ignition Off For 60 Seconds

Some 2013-2016 Fusion/MKZ, 2013-2015 C-Max, 2015 F-150/MKC vehicles may have an illuminated malfunction indicator lamp with DTC P062C that is set after performing a module programming procedure or some other service routine with the scan tool. This is likely due to the different module resets that can occur at different times for the various modules on the vehicle. If the code was not present until after performing an action with the scan tool, cycle the ignition off for 60 seconds before cycling the ignition back on. This will allow enough time for the modules to all time out, and then all turn back on together.