

# Technical Service Bulletin



## SB-10058589-5912

### 96 Lane changing assist false warnings

96 15 98 2039096/3 July 13, 2015. Supersedes Technical Service Bulletin Group 96 number 15-92 dated March 25, 2015 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A5, S5	2014	All	Not Applicable
A5, S5	2015	000001 - 055040	Not Applicable
RS 5	2014	All	Not Applicable
RS 5	2015	900001 - 901650	Not Applicable
A5 Cabriolet, S5 Cabriolet	2014	All	Not Applicable
A5 Cabriolet, S5 Cabriolet	2015	000001 - 004501	Not Applicable
RS 5 Cabriolet	2014	All	Not Applicable
RS 5 Cabriolet	2015	900001 - 900210	Not Applicable

## Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header data (Updated VIN breaks)
2	3/25/2015	Revised header data (Added A5 Coupe)
1	11/25/2014	Initial publication

- Customer may report that Audi side assist is providing false warnings (no vehicle is present in the blind spot).
- No faults related to Audi side assist are stored.
- This TSB does not refer to warning messages on the instrument cluster. It applies only to false displays of the warning lights in the door mirrors.

## Technical Background

Incorrect software parameterization.

## Production Solution

Optimized software parameterization.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the side assist control module, J769 (address word 3C) using the SVM action code as listed in the table below, if necessary.  
An update with remote control is only possible in USB operation when the USB cable is connected.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
All	8T0907566B	0071	8T0907566B	0071	3CA013

# Technical Service Bulletin



## Warranty

<b>Claim Type:</b>	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	9635		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Update side assist control module	9635 2599	Time stated on diagnostic protocol (Max 100 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2039096/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2039096) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.