

SB-10058607-9264

ONLINE AUTOMOTIVE SERVICE INFORMATION SYSTEM FOR JULY 2015

45220 2013-2015 Fusion/MKZ Hybrid - MIL And/Or Advance Trac Light With Various DTCs -
Check C3809 At Evaporative Emissions Leak Detection Control Module

Some 2013-2015 Fusion Hybrid or MKZ Hybrid vehicles may exhibit a Malfunction Indicator Lamp, and/or an Advance Trac lamp with various DTCs related to the Evaporative Emissions Leak Detection Control Module and/or a reference voltage related DTCs. DTCs P24BB, P2401, P2138, P193B, P1575, P1450, P0643, P0532, P0463, P0453, P0451, P0442, P0109, P0108 have been reported. For this condition, check C3809 at the Evaporative Emissions Leak Detection Control Module for the presence of corrosion. If corrosion is found, replace the connector using pigtail kit WPT-1349 (DU2Z-14S411-TA) and inspect the pins of the the Evaporative Emissions Leak Detection Control Module for corrosion and replace if necessary. Use applicable wire repair labor operations in Section 10 of SLTS.