



HYUNDAI | NEW THINKING.
NEW POSSIBILITIES.

Technical Service Bulletin

GROUP
BODY

NUMBER
14-BD-002


DATE
MARCH 2014

MODEL(S)
GENESIS SEDAN (BH)

SUBJECT: INTERMITTENT DOOR LOCK OPERATION

Description:

Certain Genesis Sedan (BH) vehicles may exhibit intermittent unlocking operation of the power door locks. If this condition is found, follow the inspection and repair procedure described below.

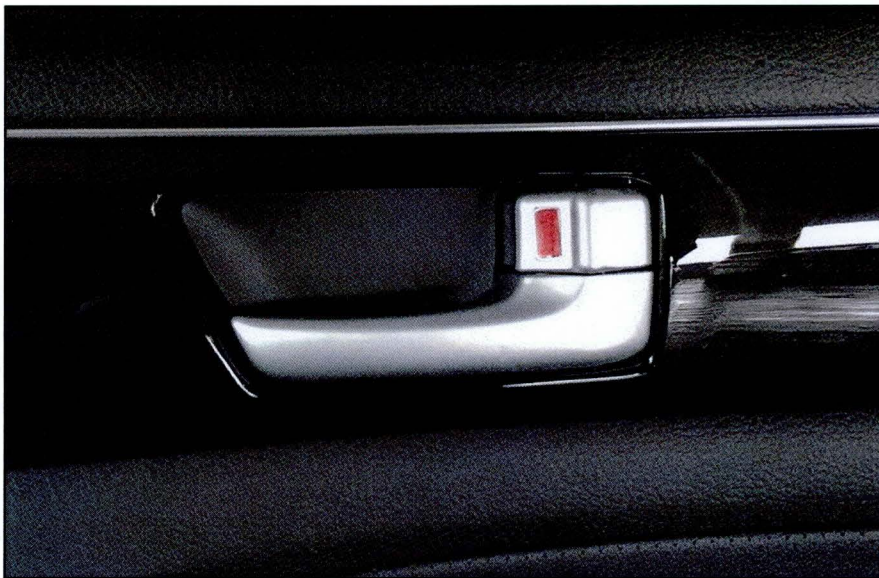

Applicable Vehicles: 2009~2014MY Genesis Sedan (BH) vehicles.


Warranty Information:

Normal warranty applies.

Circulate To: General Manager, Service Manager, Parts Manager, Warranty Manager, Service Advisors, Technicians, Body Shop Manager, Fleet Repair

Inspection Procedure:

Visually inspect the clearance between the door lock lever and the cap cover.

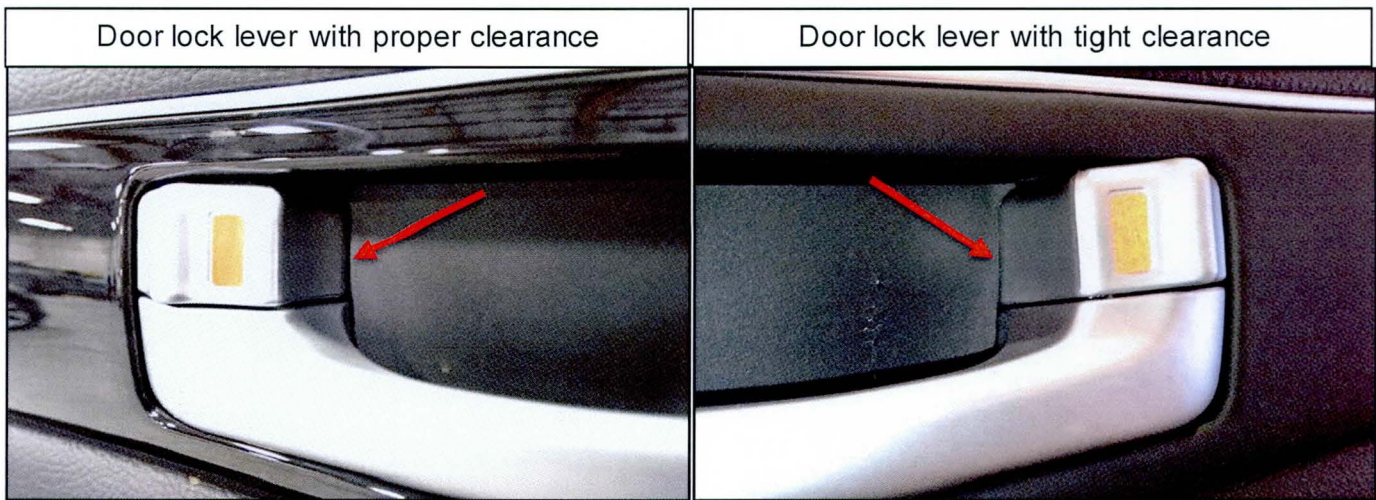

If the door lock lever has little or no clearance, or is jamming against the cap cover, proceed to the repair procedure described below.

Service Procedure:

1. Using a flathead screwdriver, carefully pry the door handle cap cover off.

NOTICE

Use care to avoid damaging the door panel.



2. Loosen the screw located beneath the cap cover.

NOTICE

Do not remove the screw.



3. Using a flathead screwdriver, carefully remove the armrest liner.

NOTICE

Use care to avoid damaging the door panel.



4. Loosen the screw located under the armrest liner.

NOTICE


Do not remove the screw.




5. To adjust the door lock lever clearance, push the door panel away from the door hinge in the direction shown.

NOTICE

Use gloves when adjusting door panel to avoid tarnishing door panel trim.

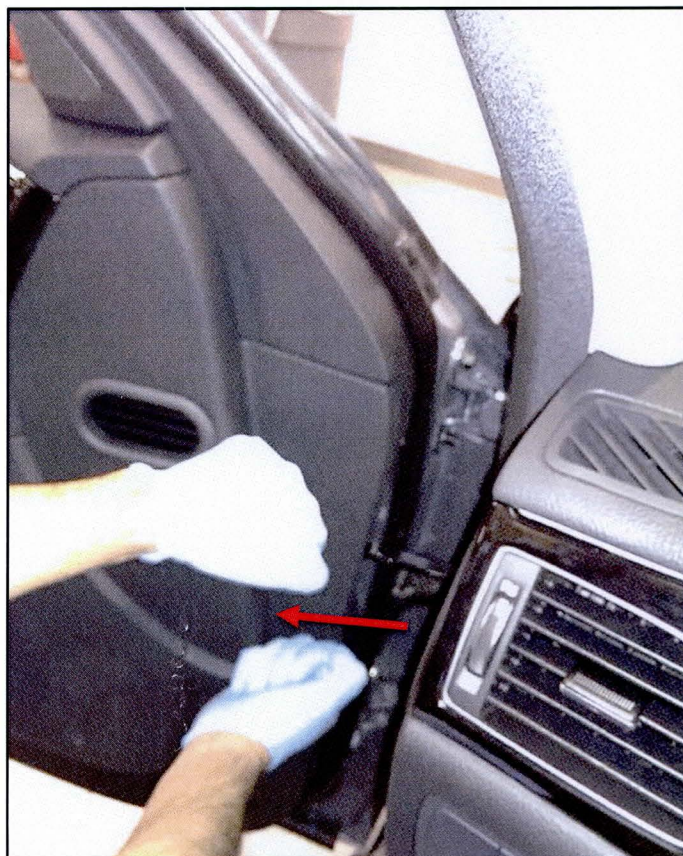

6. Adjust the door panel until there is a gap of at least 1mm between the door lock lever and the cap cover.

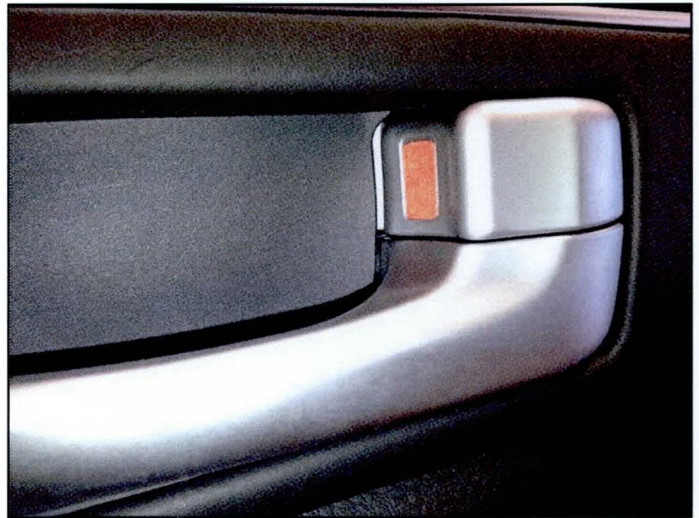

7. Retighten the screws and install the door handle cap cover and armrest liner.

8. Operate the door locks to ensure the cap cover allows clearance for the lock lever to function properly.