

© 2013 Mazda Motor of America, Inc.

**Subject:****SEAT TRACK ASSEMBLY SURFACE CORROSION OR RUST****Bulletin No:** 09-027/13**Last Issued:** 10/31/2013**APPLICABLE MODEL(S)/VINS**

2009-2011 Tribute


**DESCRIPTION**

Some vehicles may exhibit rust or corrosion on the front seat track assemblies.

Customers having this concern should have their vehicle repaired using the following repair procedure.

**REPAIR PROCEDURE**

1. Verify customer concern.
2. Remove the affected front seat assembly. Refer to MS3 online or Workshop Manual (section 09-13 FRONT SEAT REMOVAL/INSTALLATION).
3. Remove seat track from seat base. Refer to MS3 online or Workshop Manual (section 09-13 SEAT TRACK REMOVAL/INSTALLATION).
4. Clean the track assembly with a wax and grease remover and allow to dry. Use Mazda Brake Parts Cleaner or equivalent.
5. Remove rust and corrosion using 220-grit sandpaper.
6. Blow loose material from the seat track with compressed air, and clean again with Mazda Brake Parts Cleaner or equivalent.
7. Mask the motor and harness (A).

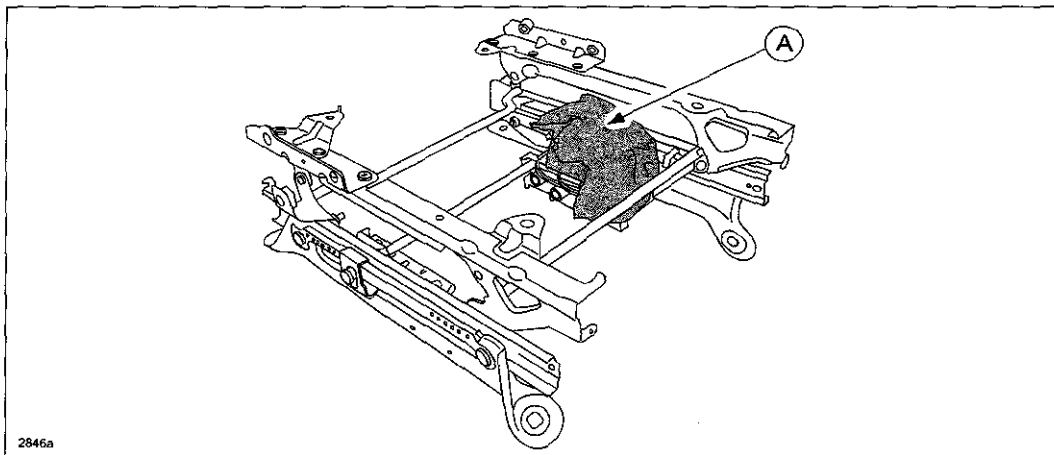

<b>Bulletin No:</b> 09-027/13 © 2013 Mazda Motor of America, Inc.	<b>Last Issued:</b> 10/31/2013
--	--------------------------------

8. Paint the seat track using Semi-Gloss Black Engine Paint or equivalent. Allow adequate time for drying.
9. Install seat track. Refer to MS3 online or Workshop Manual (section 09-13 SEAT TRACK REMOVAL/INSTALLATION).
10. Install seat. Refer to MS3 online or Workshop Manual (section 09-13 FRONT SEAT REMOVAL/INSTALLATION).
11. Verify repair.

**SHOP SUPPLY INFORMATION**

Part Number	Description	Qty.	Notes
0000-77-620E-03	Mazda Brake Parts Cleaner	1	Shop Supply
---	Semi-Gloss Black Engine Paint	1	Locally sourced
---	220 Grit Sand Paper	1	Locally sourced

**WARRANTY INFORMATION**

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A	
Symptom Code	53	
Damage Code	9Y	
Part Number Main Cause	ZZCA-53-900	
Quantity	0	
Operation Number / Labor Hours:	YY756ARX / 1.9 Hrs.	YY756BRX / 3.3 Hrs.
	Repair 1 front seat	Repair both front seats

**NOTE:** Do not claim the shop supply parts as a related part. The shop supply used for this repair is included in the labor allowance.