

NUMBER: 02-002-13 GROUP: Front Suspension DATE: April 04, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

# SUBJECT:

1

Cold Weather Noise From Front End Over Bumps

## OVERVIEW:

This bulletin involves replacing both left and right front jounce bumpers.

## MODELS:

2012-2013 (FF) Fiat 500

## NOTE: This bulletin applies to vehicles built prior to March 7, 2013 (MDH 0307XX).

#### SYMPTOM/CONDITION:

The customer may experience a noise from the front of the vehicle while going over bumps which may be more noticeable in colder temperatures.

#### **DIAGNOSIS:**

If the customer describes the symptom, perform the Repair Procedure.

## PARTS REQUIRED:

Qty.	Part No.	Description	
2	68073020AB	Bumper, Jounce - Front	

## REPAIR PROCEDURE:

- Remove and disassemble the left and right front strut assemblies. Refer to the detailed removal procedures available in DealerConnect>TechCONNECT> under: Service Info> 02 - Front Suspension> Front> STRUT, Suspension, Assembly> Removal/Disassembly.
- 2. Replace both left and right front jounce bumpers (4) (Fig. 1).

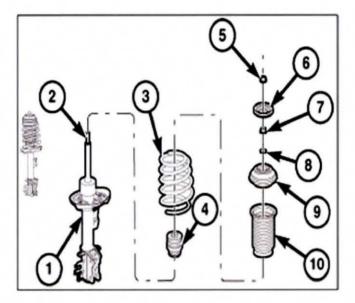


Fig. 1 Strut Disassembly

- 1 Strut Damper Assembly
- 2 Strut Damper Shaft
- 3 Coil Spring
- 4 Jounce Bumper
- 5-10 Upper Mount/Retainer and Dust Boot Assembly
- Reassemble and install the left and right front strut assemblies. Refer to the detailed removal procedures available in DealerConnect>TechCONNECT> under: Service Info> 02 - Front Suspension> Front> STRUT, Suspension, Assembly> Assembly/Installation.

## NOTE: Verify wheel alignment is within specifications. (Refer to 02 - Front Suspension/Wheel Alignment - Standard Procedure/Specifications).

## POLICY:

Reimbursable within the provisions of the warranty.

## TIME ALLOWANCE:

Labor Operation No:	Description	Amount
02-27-20-93	Replace Both Front Jounce Bumpers (2 - Skilled)	1.4 Hrs.

## FAILURE CODE:

ervice Action	
e	ervice Action