



NUMBER: 08-051-13

GROUP: Electrical

DATE: July 12, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

HELP USING THE wiTECH DIAGNOSTIC APPLICATION FOR FLASHING AN ECU IS AVAILABLE BY SELECTING "HELP" THEN "HELP CONTENTS" AT THE TOP OF THE wiTECH DIAGNOSTIC APPLICATION WINDOW.

THE wiTECH SOFTWARE LEVEL MUST BE AT RELEASE 13.04 OR HIGHER TO PERFORM THIS PROCEDURE.

SUBJECT:

Flash: Park Assist Setup Display Doesn't Match Option

OVERVIEW:

This Bulletin involves updating the Cab Compartment Node (CCN) software.

MODELS:

2012-2013 (WK) Grand Cherokee (International only)

NOTE: This bulletin applies to vehicles built to Export MKT, Specification (sales code YAB) with Rear Park Assist System (sales code XAA) or Parksense FT/RR Park Assist System (sales code XAG).

SYMPTOM/CONDITION:

A customer may note when changing the Park assist setting the display will show Blind spot setup choices. This will happen when the cluster language is set to anything but English.

DIAGNOSIS:

If the customer describes the symptom, perform the Repair Procedure.

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the CCN with the latest software. Help using the wiTECH diagnostic application for flashing an CCN is available by selecting "help" then "help contents" at the top of the wiTECH diagnostic application window.
2. Clear any DTC's that may have been set in all modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow the tech to clear them.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
18-19-45-9F	Module, Cab Compartment Node (CCN), Reprogram. (1 - Semi-Skilled)	0.4 Hrs.

FAILURE CODE:

FM	Flash Module
----	--------------