



NUMBER: 23-016-13
GROUP: Body
DATE: April 20, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:
 Driver And/Or Passenger Seat Fore/Aft Movement During Acceleration And/Or Braking

OVERVIEW:
 This bulletin involves replacing the power seat track drive block bolts on front driver and/or passenger seat.

MODELS:

2011- 2013	(LC)	Challenger
2011- 2013	(LD)	Charger
2011- 2013	(LX)	300

NOTE: This bulletin applies to vehicles built prior to February 26, 2012 (MDH 0226XX) equipped with power driver and/or passenger seat (sales codes JPS, JPR, JPT).

SYMPTOM/CONDITION:
 The customer may experience up to 1mm(1/32") fore/aft movement of the driver and/or passenger seat during acceleration and/or braking.

DIAGNOSIS:
 Sit in the suspect seat and subjectively evaluate the customer concern. If the customer complaint can be confirmed as fore/aft looseness or rough travel during seat adjuster operation, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
8 (AR)	68203613AA	Bolt

SPECIAL TOOLS/EQUIPMENT REQUIRED:

NPN	Torque Wrench
-----	---------------

REPAIR PROCEDURE:

1. Remove the suspect seat(s). Refer to the detailed procedures available in DealerConnect> TechCONNECT under: Service info> 23-Body> Seats, Front> SEAT, Front> Removal.

NOTE: The seat(s) do not need to be fully removed from the vehicle to complete the repair. Lift seat so that the rear locating pins clear the body and lean seat back in vehicle.

2. Remove one of the drive block bolts (1) from the bottom of the seat frame at a time and remove the plastic spacer (2) from the old bolt and reinstall it on the new bolt p/n 68203613AA.
3. Reinstall the new bolt into the bottom of the seat frame (3) and tighten it to 15Nm(11ft/lbs.). Repeat for the remaining bolts and/or seat.

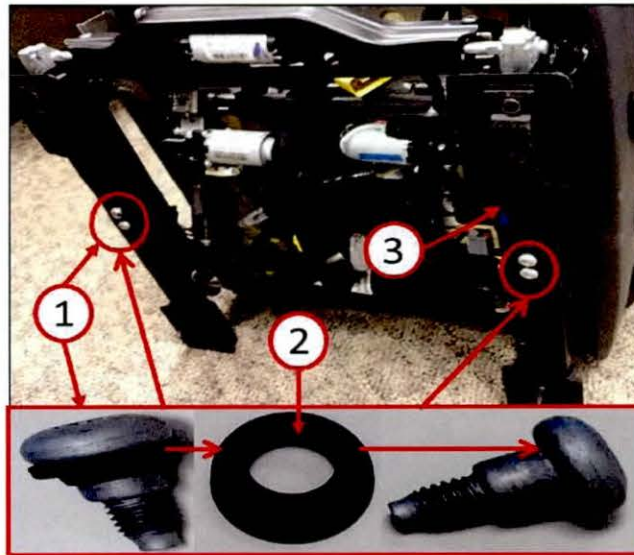


Fig. 1 Replace Drive Block Bolts

- 1 - Drive Block Bolts (bottom of seat frame)
- 2 - Plastic Drive Block Spacer (transfer from old to new bolt)
- 3 - Seat Frame (view from bottom)

4. Reinstall the suspect seat(s). Refer to the detailed procedures available in DealerConnect> TechCONNECT under: Service info> 23-Body> Seats, Front> SEAT, Front> Installation.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-13-60-9A	Replace Power Seat Track Drive Block Bolts (Drivers Seat Only) (1 - Semi-Skilled)	0.3 Hrs.
23-13-60-9B	Replace Power Seat Track Drive Block Bolts (Both Front Seats)	0.5 Hrs.

	(1 - Semi-Skilled)	
--	--------------------	--

FAILURE CODE:

ZZ	Service Action
----	----------------