

TECHNICAL BULLETIN
JTB00275NAS2
24 OCT 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions. Only refer to the electronic version of this Technical Bulletin in TOPIx.

Changes are highlighted in gray

SECTION: 501-10

Folding Tray Latch Broken

AFFECTED VEHICLE RANGE:

XJ Range (X351)

Model Year: 2012-2013

VIN: V25520-V59157

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The folding tray latch may not latch closed and/or the latch may be broken.

Cause: This may be caused by washers fitted behind latch, resulting in increased force at latch fixing point.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

C2D13489XXX Picnic Tray Latch Quantity: 2

C2D38514 Spacer Quantity: 2

TOOLS:

No Tools Required

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Folding tray latch - Pair - Renew	76.14.16	0.2	01	C2D13489

 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1. Open the left-side folding tray.




E127925

2.  **NOTE: Discard any washers found behind the fixing.**

Remove and discard the folding tray latch.

- Remove the fixing.

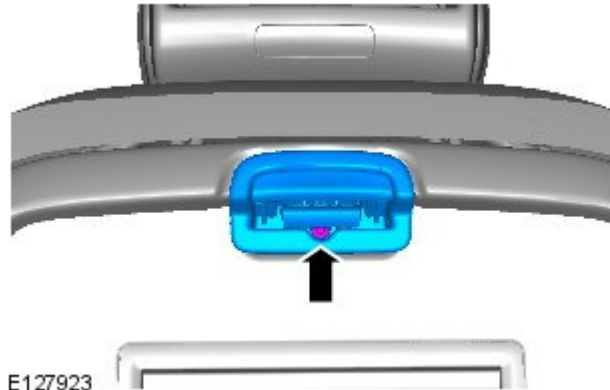

E127923


3. Install the new spacer on to the new folding tray latch.



E159920

4. Install the new folding tray latch.

- Install the fixing.

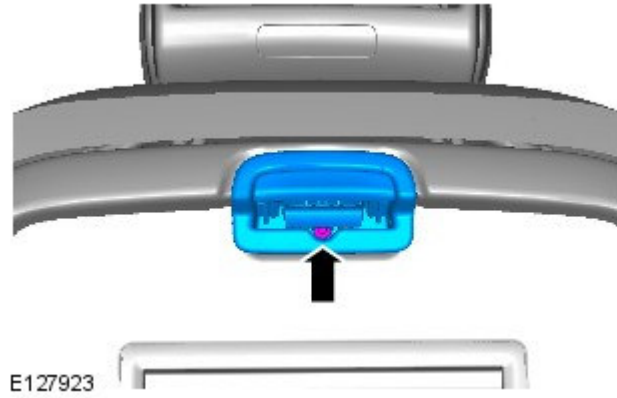

5. Close the folding tray.
6. Carry out steps 1-5 to the right-side folding tray latch.