

Technical Service Bulletin

GROUP	NUMBER	
ACCESSORY	14-AC-002-1	
DATE	MODEL(S)	
JUNE 2014	(See applicable models below)	

SUBJECT: REMOTE ENGINE START (RES) DIAGNOSIS AND REPLACEMENT PARTS

THIS TSB SUPERSEDES TSB 14-AC-002 to provide a Diagnostic Troubleshooting Guide.

Description:

This bulletin describes the diagnosis procedure and list of replacement service parts for the Remote Engine Start (RES) accessory. Follow the troubleshooting guide in this bulletin and then select the appropriate part by referring to the Parts Information and Vehicle Application section. When troubleshooting Remote Engine Start operation, replace only the individual component required for proper operation. Do not order/replace the entire Remote Engine Start Kit.



NOTICE

Do not order the complete Remote Engine Start Accessory Kit to troubleshoot or replace a single component. Order the parts separately.

Warranty Information:

When replacing a part from the Remote Engine Start kit, determine the appropriate operation code by referring to the Parts Information and Vehicle Application section on pages 7 and 8. A list of applicable Nature Codes and Cause Codes is available on page 9.

Diagnosis Information:

Follow the troubleshooting guide below, proceeding from left to right until the root cause is found. Replace the appropriate part according to the blue "Replacement Part Suggestion" box by referring to the Parts Information section.


NOTICE

Troubleshooting information and replacement service part for the Remote Engine Start accessory can also be found in the Installation Instructions provided in each Remote Engine Start accessory kit.


NOTICE

TIPS FOR DIAGNOSIS


- Always first check the key fob batteries and replace if necessary.
- When checking the wiring harness, be sure to check for pinched/cut wires, bent pins, terminal corrosion or pin tension.
- Use a GDS to verify the trunk/tailgate and hood switches are functioning properly.

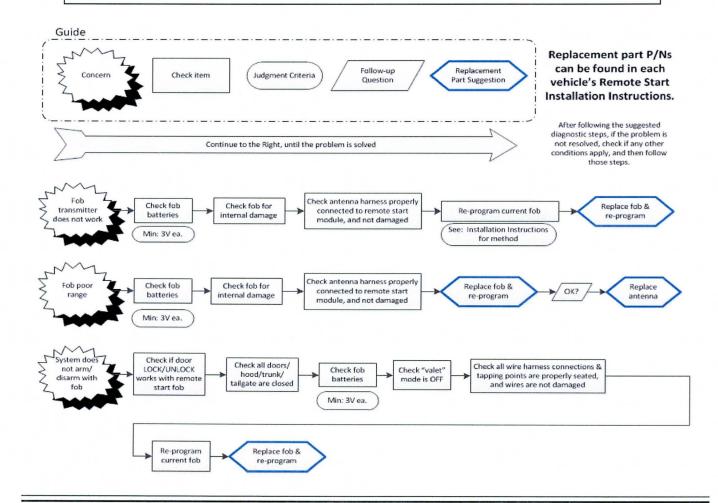


TSB #: 14-AC-002-1 Page 2 of 9

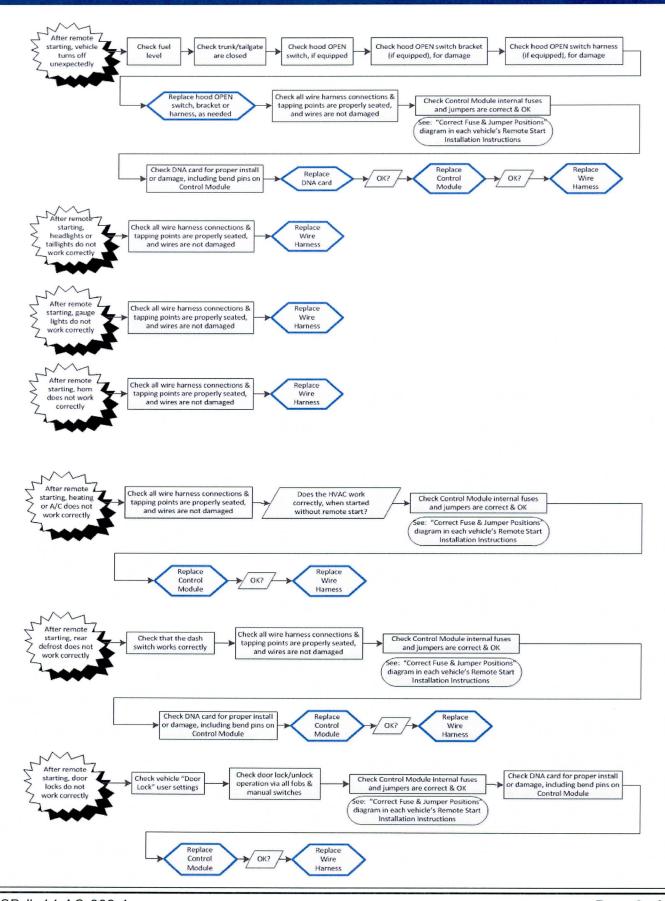

TSB #: 14-AC-002-1 Page 3 of 9

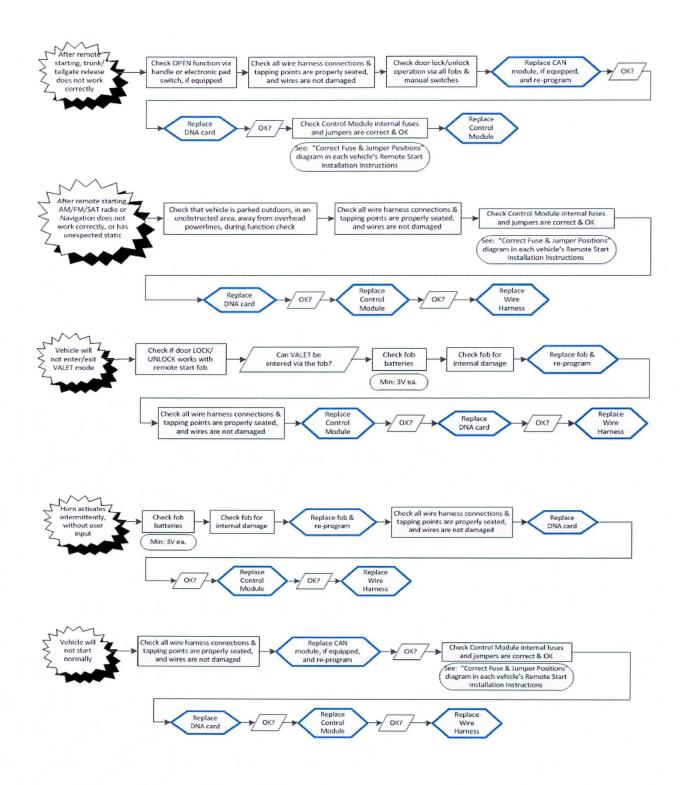


TSB #: 14-AC-002-1 Page 4 of 9

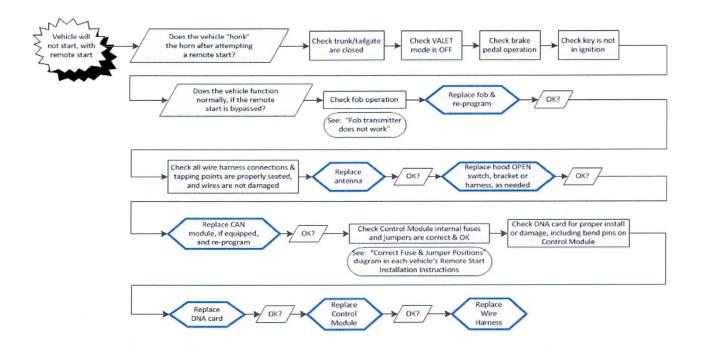

NOTICE

Installation instructions can also be found online at: www.hyundaitechinfo.com Click on "Service Information", then click on "Accessory Info".

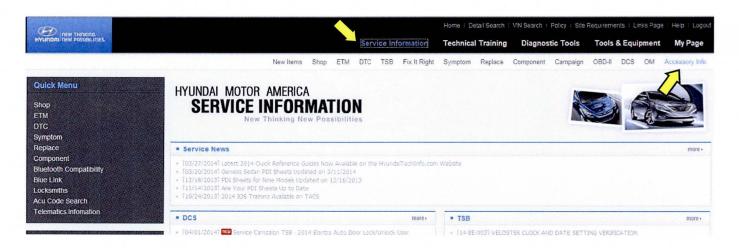



If additional diagnostic assistance is required, contact Hyundai Techline at 1-800-325-6604. For faster service, please complete the Techline Diagnostic Sheet prior to calling. The Techline Diagnostic Sheet is found online at: www.hyundaitechinfo.com. Click on "Technical Training", then "Techline Procedures".

TSB #: 14-AC-002-1 Page 5 of 9

Replacement Service Parts:



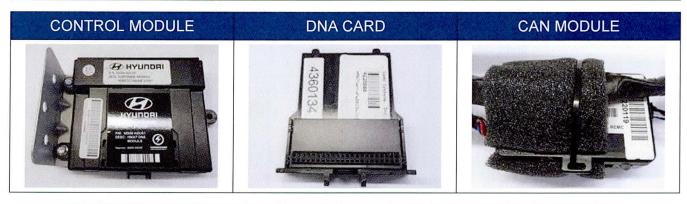

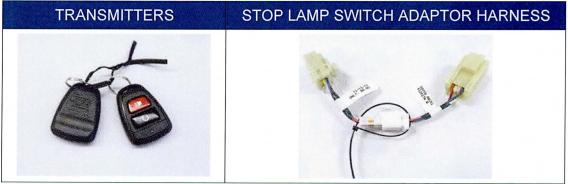

- The replacement parts in this bulletin are available as separate components.
- When troubleshooting the Remote Engine Start accessory, identify the suspected causal part and determine the correct part number for the model year and vehicle application from the tables in this bulletin.

TSB #: 14-AC-002-1 Page 6 of 9

Parts Information and Vehicle Application:

MY	Model	Causal Part No.	Part Description	Op Code	Op Time
2010 - 2012	Santa Fe (CM)	00056-ADU00	TRANSMITTER		
2010 - 2013	Tucson (LM)	00036-AD000	(4-Button)	A0603R02	0.3
2012 - 2014	Veloster (FS)				
2011 - 2014	Sonata (YF)	00056-ADU10 TRANSMITTER (6-Button)	TRANSMITTER		
2011 - 2014	Elantra (UD/MD)		7 100001102	0.0	
2013 - 2014	Elantra GT (GD)				
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)	00056-ADU90	TRANSMITTER (2-Button)		
2010 - 2012	Santa Fe (CM)				
2010 - 2013	Tucson (LM)				
2012 - 2014	Veloster (FS)				
2011 - 2014	Sonata (YF)	00056 ADU20	CONTROL MODULE	A0603R03	0.6
2011 - 2014	Elantra (UD/MD)	00030 AD020	CONTINUE MOBULE	7100001100	G.G
2013 - 2014	Elantra GT (GD)	1 17			
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)				
2010 - 2012	Santa Fe (CM)	00056 ADU30			
2010 - 2012	Santa Fe (CM)	00056 ADU31			
2010 - 2013	Tucson (LM)	00056 ADU60			
2012 - 2014	Veloster (FS)	2V056 ADUS1			
2011 - 2013	Sonata (YF)	00056 ADU70	DNA CARD	A0603R04	0.6
2014	Sonata (YF)	00056 ADU71	DIVI ONICD		
2011 - 2014	Elantra (UD/MD)	00056 ADU80			
2013 - 2014	Elantra GT (GD)	2V056 ADUS1			
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)	4Z056 ADUS1			

TSB #: 14-AC-002-1 Page 7 of 9

Parts Information and Vehicle Application (con't.):

MY	Model	Causal Part No.	Part Description	Op Code	Op Time
2010 - 2012	Santa Fe (CM)	2B056 ADU10		A0603R05	0.6
2010 - 2013	Tucson (LM)	2S056 ADU10			
2012 - 2014	Veloster (FS)	2V056 ADUS2			
2011 - 2014	Sonata (YF)	3S056 ADU10	MAIN WIRE HARNESS		
2011 - 2014	Elantra (UD/MD)	3X056 ADU10			
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)	4Z056 ADUS2			
2010 - 2012	Santa Fe (CM)				0.3
2010 - 2013	Tucson (LM)				
2012 - 2014	Veloster (FS)	00056 ADU40	PROGRAM BUTTON	A0603R06	
2011 - 2014	Sonata (YF)	00030 AD040	WIRE HARNESS		
2011 - 2014	Elantra (UD/MD)	.*			
2013 - 2014	Santa Fe Sport (AN)	A 1			
2013 - 2014	Santa Fe (NC)	00056 ADU40	PROGRAM BUTTON	A0603R06	0.6
2013 - 2014	Elantra GT (GD)	00056 AD040	WIRE HARNESS		
2010 - 2012	Santa Fe (CM)			A0603R07	0.3
2010 - 2013	Tucson (LM)	E = 1 1	ANTENNA		
2012 - 2014	Veloster (FS)	<u> </u>			
2011 - 2014	Sonata (YF)	00056 ADU50			
2011 - 2014	Elantra (UD/MD)	00000712000			
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)				
2013 - 2014	Elantra GT (GD)				
2013 - 2014	Santa Fe Sport (AN) Santa Fe (NC)	4Z056 ADUS3	CAN MODULE	A0603R08	0.4
2013 - 2014	Veloster (FS)	00050 ADUO0		A0603R09	
2013 - 2014	Sonata (YF)	00056 ADUS0	STOP LAMP SWITCH ADAPTOR HARNESS		0.3
2014	Santa Fe Sport (AN)	00056 ADUG4			
2013 - 2014	Santa Fe (NC)	00056 ADUS1			
2014	Elantra (UD/MD)	00056 ADUGO			
2014	Elantra GT (GD)	00056 ADUS2			

TSB #: 14-AC-002-1 Page 8 of 9

Parts Information and Vehicle Application (con't.):

Nature Code	Description	Cause Code	Description
N59	Broken, Crack	C06	Broken, Split, Torn
N66	Electrical Malfunction	C07	Cracked
N94	Inoperative	C15	Poor Contact, Open Circuit
N99	Other	C20	Poor Insulation
		C61	Incorrect Part
		C62	Missing Part
		C99	Other

TSB #: 14-AC-002-1 Page 9 of 9