

Technical Service Bulletin



30 Clutch pedal makes noises when pressed

30 13 17 2032224/2 January 8, 2013. Supersedes Technical Service Bulletin Group 30 number 12-16 dated December 21, 2012 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
TT	2012-13	All	Manual transmission
A3			

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Header</i> data
1	Dec 21, 2012	Original

- Clicking or knocking noise when pressing the clutch pedal.
- Impulse noticeable when pressing the clutch pedal.

Technical Background

Excess clearance between mounting of clutch master cylinder and pedal assembly.

Production Solution

Not Applicable

Service

Replace mounting on clutch pedal and attach felt pieces on mounting to remove clearance.

1. Remove the mounting on the clutch pedal (Figure 3) according to the repair manual and discard.
2. From part number: **533 867 910 A** cut two felt pieces 16mm long. (Figure 1)



Figure 1. Felt pieces.

3. On the short side cut into the felt pieces to approximately half the length (Figure 2)



Figure 2. Cutting felt.

4. While holding the mounting (part number: **1K0 721 357 A**) closed (Figure 3), install felt strip onto both sides of mounting.

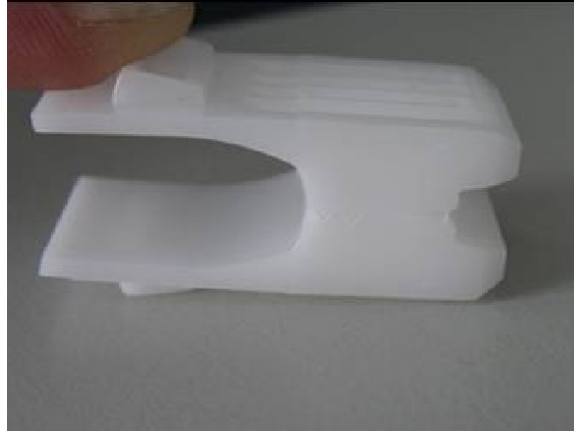


Figure 3. Mounting held together before installing felt.

5. Install the felt a distance of 7 mm from tip on the depressed mounting on both sides. (Figure 4).



Figure 4. Distance of felt installed from end.



Tip: Figure 4 shows the relaxed condition of the mounting.

6. Install the mounting on the clutch pedal according to the repair manual.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	3005		
Damage Code:	0020		
Labor Operations:	Remove clutch pedal	3005 1900	See ELSA Web for applicable TUs.
	Replace clutch pedal mounting and install felt	3005 5599	10 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer' s discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2032224/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Required Parts and Tools

Part number	Description	Quantity
533867910A	Felt strip	1
1K0721357A	Mounting	1

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.