

Tech Tips

TT 28-08-02

Date: 2008

2005> Jetta A5, - Key Cannot Be Removed from the Ignition when the Transmission is in PARK

November 29, 2013: Update to information.

If a customer comments that the key **cannot** be removed from the ignition when the transmission is in PARK or that the PRND12 is not reading correctly in the MFI, DO NOT replace the ignition switch, lock cylinder, or lock housing assembly. Instead, be sure the Ignition lock solenoid is working properly and/or check that the N376 (**called the "catch"**), is connected to the lock housing. In some cases you may get a fault code 00194 009 Ignition key removal from lock open circuit/ short to earth. Use MVB 5 in address word 16-Steering Column Electronics for an aid in diagnosis. **Please be certain to use the VIN in ETKA to obtain the latest part number(s) available.**

