



Service Bulletin

File in Section: -

Bulletin No.: PI0950

Date: April, 2013

PRELIMINARY INFORMATION

Subject: Automatic Transmission Fluid Leak from Torque Converter Housing Area

Models: 2010-2013 Buick LaCrosse
2011-2013 Buick Regal
2012-2013 Buick Verano
2008-2013 Chevrolet Malibu
2010-2013 Chevrolet Equinox
2011-2013 Chevrolet Cruze
2012-2013 Chevrolet Captiva Sport, Sonic
2010-2013 GMC Terrain
2009-2010 Saturn AURA
Equipped with 6T30, 6T40, 6T45, 6T50 Automatic Transmission (RPOs MHC, MHH, MHJ, MHK, MH9)
Vehicles Built Prior to February 1, 2013

Condition/Concern

Some customers may comment on an automatic transmission fluid leak. Upon further investigation, the technician may find fluid leaking from the torque converter housing and the torque converter seal.

Recommendation/Instructions

Important: It is recommended that a new torque converter seal be installed any time the transmission is removed from the vehicle for any reason. **DO NOT** remove the transmission from the vehicle to replace the torque converter seal unless there is a torque converter seal leak or other internal transmission repairs are needed.

If diagnosis determines that the leak is the torque converter seal, the seal should be replaced. A torque converter seal that makes use of a more robust sealing material is now available.

This revised seal is also included in the automatic transmission seal kit P/Ns 24269583, 24267774, 24267569 and 24267776.

Note: **DO NOT** order a seal kit unless it is necessary to remove the transmission from the vehicle to perform internal transmission repairs.

Parts Information

Part Number	Description
24256953	Seal, T/CV Fluid

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
K7060	Torque Converter Fluid Seal Replacement	Use Published Labor Operation Time