



Service Bulletin

File in Section: -

Bulletin No.: PI0984

Date: June, 2013

PRELIMINARY INFORMATION


Subject: Revised Liftgate Strut Replacement Procedure

Models: 2008-2012 Buick Enclave
2009-2012 Chevrolet Traverse
2007-2012 GMC Acadia
2007-2010 Saturn OUTLOOK

Condition/Concern

GM engineering has determined that improved durability of the liftgate strut can be realized by installing the strut assembly with the rod side down. In this orientation, dust and dirt does not collect on the strut housing to rod seal, which can cause wear on the seal.

Recommendation/Instructions

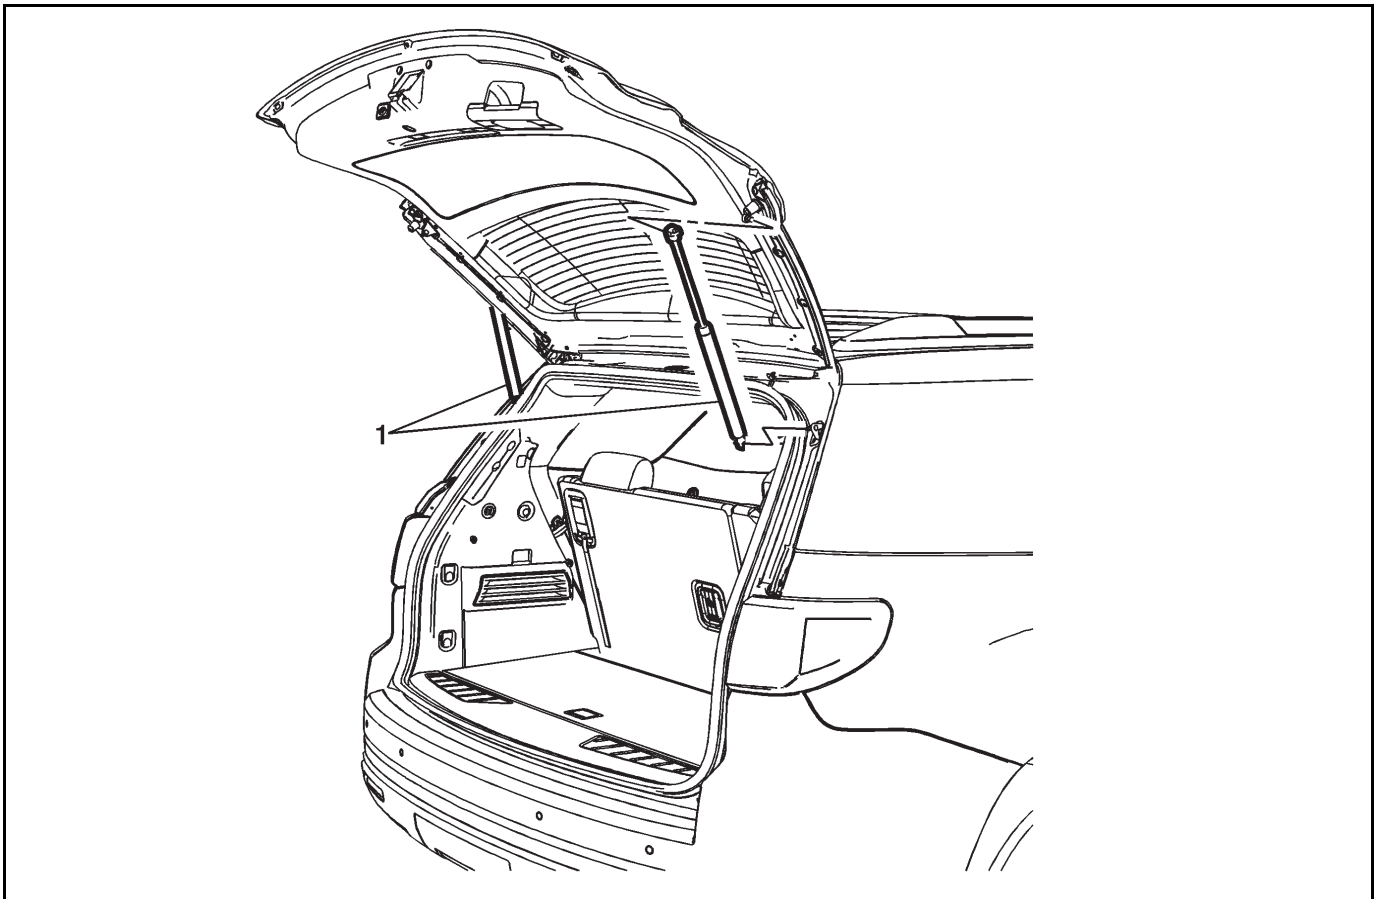

2878222

When it is necessary to replace a liftgate strut, install the strut assembly with the strut body end attached to the body side of the vehicle and the rod side attached to the liftgate (1).

Important: This revised installation procedure applies to all vehicles even if the struts were installed in a different orientation from the factory.