



Service Bulletin

File in Section: -

Bulletin No.: PIP5071

Date: October, 2012

PRELIMINARY INFORMATION

Subject: Squawk Or Grunt Noise On The 2-3 Shift

Models: 2008-2009 Chevrolet Avalanche, Suburban, Tahoe
2008-2012 Chevrolet Colorado
2008-2013 Chevrolet Express, Silverado
2008-2009 Chevrolet Trailblazer, Trailblazer SS
2008-2012 GMC Canyon
2008-2009 GMC Envoy
2008-2013 GMC Savana, Sierra
2008-2009 GMC Yukon, Yukon XL
2008-2009 Hummer H3
2008-2009 Saab 9-7X, 9-7X Aero
Equipped with 4L60E, 4L65E or 4L70E (RPO - M30, M32 or M70) Transmission

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Customers may comment that the transmission makes a squawk or grunt type noise when shifting from 2nd to 3rd gear.

Recommendation/Instructions

The 3-4 clutch Friction (654A) and Steel (654B) Clutch Plates along with the Apply Plate (653) and Selective Backing Plate (655) should be replaced.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation

Description

Labor Time

K7252

3-4 Clutch Replacement

Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.