



Tech Tips

TT 13-12-01

Date: September 28, 2012

2009-2010 Routan – DTC P0339 “Crankshaft Position Sensor Intermittent” Diagnosis Tip

When diagnosing DTC P0339 “Crankshaft Position Sensor Intermittent”, use StarMOBILE to select the PCM OBD II Monitor List, select “Cam Crank Synchronization Event Monitor”, and read both the “Engine Unlock Position and the “Unlock RPM” status. If value for “Unlock RPM” is greater than 3000 RPM, inspect for a warped flexplate before performing any other repair.