



Service Bulletin

File in Section: -

Bulletin No.: 15-NA-019

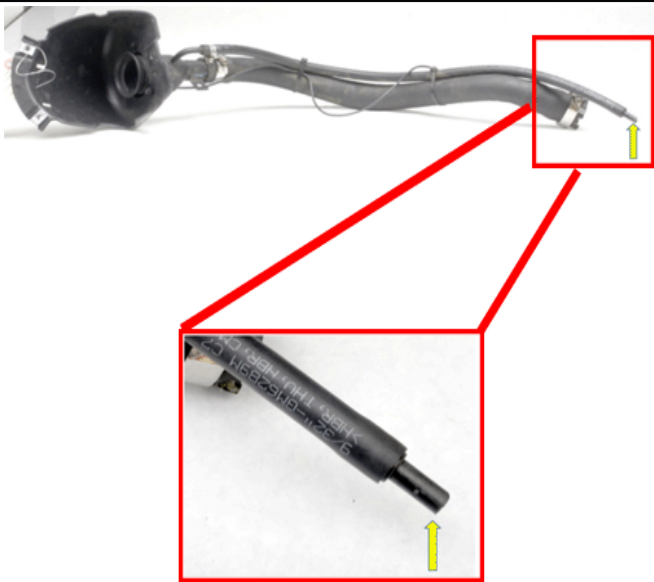
Date: October, 2015

TECHNICAL

Subject: Fuel Odor During Fuel Filling or During Idle, Possible P0442 or P0455 DTCs Set

Attention: This Bulletin also applies to any of the models that may be Export vehicles.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2013	2015			All	All
Chevrolet	Avalanche	2013	2013			All	All
Chevrolet	Silverado Light Duty	2013	2013			All	All
Chevrolet	Silverado 1500	2014	2015			All	All
Chevrolet	Suburban	2013	2015			All	All
Chevrolet	Tahoe	2013	2015			All	All
GMC	Sierra Light Duty	2013	2013			All	All
GMC	Sierra 1500	2014	2015			All	All
GMC	Yukon Models	2013	2015			All	All

Condition	Some customers may comment on a strong fuel odor during fuel filling or during vehicle idle.
Cause	 <p style="text-align: right;">4283370</p> <p>This may be caused by the fracture or breaking of the gasoline filler neck recirculation line connector.</p>

Correction

If you encounter a vehicle with the above concern, complete the following procedure:

1. Raise the vehicle and visually inspect the fuel tank filler vent hose connector for damage. Refer to Lifting and Jacking the Vehicle in SI.
 - If connector is damaged, replace the fuel tank filler vent hose. Refer to Fuel Tank Filler Vent Hose Replacement in SI.
 - If there is no damage to the connector, continue diagnosis referring to SI.

Parts Information

Description	Part Number
HOSE ASM-F/TNK FIL VENT	22802073
HOSE ASM-F/TNK FIL VENT	22802074
HOSE ASM-F/TNK FIL VENT	22802075
STRAP*	12337820*

*This part will not be necessary for all applications.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4028570*	Fuel Tank Filler Vent Hose Replacement	0.3 hr

*The next update of the Labor Time Guide will contain this code.

Version	1
Modified	

