

Reference	SSM71989
Models	F-TYPE / X152 XE / X760 XF / X250 XJ / X351 XK / X150
Title	Instrument Pack Lower level Assembly Lens Replacement
Category	Body
Last modified	17-Jun-2015 00:00:00
Symptom	107000 Interior Trim

Content**Issue:**

Customer complains of damage/markings on the surface of the vehicle's instrument pack lens.

Cause:

Damage/markings caused by object impact against the lens. Staining/discoloration contamination caused by using any type of cleaning product on lens.

Action:

Where a customer concern is reported, please order the Lens Kit for the relevant model as listed below;

Model year & Part Number

X250 09-11MY - C2Z26950

X250 12MY On - C2P25861

X152 14MY On - T2R16687

X152 16 MY FROM K22185 - T2R18772

X150 ALL MY - C2P258861

X760 ALL MY - T2R16687

Then refer to Topix Procedure: Service; Workshop Information; Workshop Manual; Workshop manual Vehicle Model, 4: Electrical; 413: Instrumentation and Warning Systems; 413-01 Instrument Cluster; Removal and Installation - Instrument Cluster Lens.

Notes: **Any marks or damage following PDI are not covered by warranty.**

X351 does not have the lens kit available, but an attempt to clean it first should be made (as per owners handbook instruction), before replacing the complete cluster - if found marked at PDI.