

Service Bulletin

File in Section:

Bulletin No.: 16-NA-146

Date: May, 2016

TECHNICAL

Subject: Power Liftgate Does Not Stay Fully Open or Drifts Down a Few Inches

| Brand: Model: | | Model Year: | | VIN: | | Engine: | Transmission: |
|---------------|---------|-------------|------|------|----|---------|---------------|
| Біапи. | wiodei. | from | to | from | to | | |
| Chevrolet | Equinox | 2010 | 2017 | | | All | All |
| GMC | Terrain | 2010 | 2017 | | - | All | All |

| Involved Region or Country | North America and UAE |
|----------------------------|---|
| Additional Options (RPO) | Equipped with Power Lift Gate (RPO TB5) |
| Condition | Some customers may comment that after opening the power liftgate, it will not stay in the full open position and may drift down a few inches before coming to a rest. |
| Cause | This may be caused by an incorrect ball stud strut bracket installed during assembly. |

Correction

If you encounter a vehicle with the above concern, complete the following steps:



2598278

 Open the liftgate and inspect all four of the liftgate mounting brackets for a letter P or M stamped on the bracket.

Note: P is for a power liftgate system and M is for a Manual liftgate system.

If Manual strut mount bracket(s) are found on the vehicle, replace with the correct bracket(s) for power liftgate.

Note: Be sure to tighten the brackets to 25 N·m +/- 5 N·m

Parts Information

| Description | Part Number | Model Years | |
|--|----------------|----------------|--|
| BRACKET ASM-L/GATE STRUT (BODY SI) (RH) | 20800141 | 2010-2015 | |
| BRACKET ASM-L/GATE STRUT (BODY SI) (LH) | 20942418 | 2010-2015 | |
| BRACKET ASM-L/GATE STRUT (BODY SI) (LH) | 23415390 | 2016-2017 | |
| BRACKET ASM-L/GATE STRUT (BODY SI) (RH) | 23318692 | 2016-2017 | |
| BRACKET ASM-L/GATE STRUT (L/GATE SI) (LH) | 23488122 | 2016-2017 | |
| BRACKET ASM-L/GATE STRUT (L/GATE SI) (RH) | 23318693 | 2016-2017 | |

Warranty Information

| Labor Operation | Description | Labor Time |
|--|------------------------------------|------------|
| 2080648* | Liftgate Bracket(s) Replacement | 0.5 hr |
| *This is a unique Labor Operation for Bulletin use only. | | |

| Version | 1 |
|----------|---|
| Modified | |