

Technical Service Bulletin Number
--

TSB160010



Technical Service Bulletin

Subject

INSITE™ Electronic Service Tool Error When Adjusting Aftertreatment Diesel Exhaust Fluid Level System Configuration Programmable Parameters

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISB4.5 CM2350 B104
- ISB6.7 CM2350 B101
- ISB6.7 CM2350 B103
- ISL9 CM2350 L101
- ISL9 CM2350 L111
- ISX12 CM2350 X101
- ISX15 CM2350 X102

Issue

When making adjustments to Aftertreatment Diesel Exhaust Fluid Level System Configuration programmable parameters with INSITE™ electronic service tool, an error message will be encountered.

Verification

When adjusting the values of Aftertreatment Diesel Exhaust Fluid Inducement Level, Aftertreatment Diesel Exhaust Fluid Low Level, or Aftertreatment Diesel Exhaust Fluid Warning Level with INSITE™ electronic service tool on Model Year 2015 and Model Year 2016 engines, an error message will display as shown in Figure 1 below.

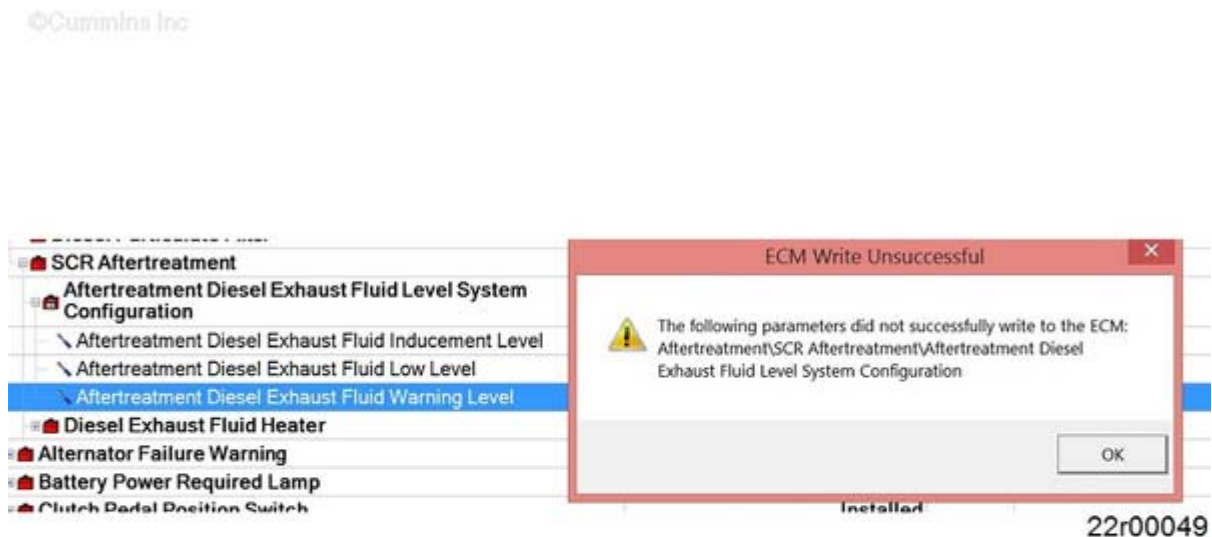


Figure 1, ECM Write Unsuccessful Error Message

Resolution

- Disregard the engine control module (ECM) Write Unsuccessful error message. The parameters will write and save to ECM memory.
- The error message issue will be resolved in a future software release scheduled for mid-year 2016.

Document History

Date	Details
2016-2-2	Module Created

Last Modified: 04-Feb-2016