Field Service Bulletin Trucks



 Date
 Group
 No.
 Release
 Page

 11.2014
 **364 038 01** 1(3)

Vehicle Electronic Control Unit (VECU), Reprogramming Fifth Wheel Slide CHU, CXU, GU, TD


## FSB 364-038, Vehicle Electronic Control Unit (VECU), Reprogramming

**Fifth Wheel Slide** 

(November 2014)

Certain MACK CHU, CXU, GU, and TD trucks equipped with an air slide fifth wheel, and built 08/18/2014 through 11/07/2014, may display a "Fifth Wheel Slide Fault" message in the instrument cluster when the vehicle shuts OFF during Idle Shutdown. This condition is due to a parameter programming issue. The procedure outlined in this Field Service Bulletin (FSB) will reset the parameter correctly.

Note: This bulletin does not apply to MACK Trucks Australia.

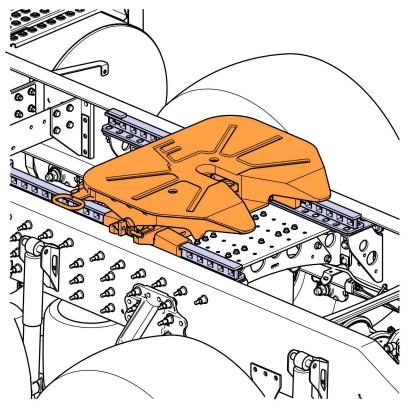

W9083935


Mack Trucks, Inc.	Date	Group	No.	Release	Page
Field Service Bulletin	11.2014	364	038	01	2(3)

## **Repair, Reprogramming Procedure**

You must read and understand the precautions and guidelines in Service Information, group 80, "General Safety Practices, Body, Cab, and HVAC" before performing this procedure. If you are not properly trained and certified in this procedure, ask your supervisor for training before you perform it.


**NOTE:** Information is subject to change without notice. Illustrations are used for reference only and can differ slightly from the actual vehicle being serviced. However, key components addressed in this information are represented as accurately as possible.

- 1 Park the vehicle on a flat and level surface.
- 2 Apply the parking brake.
- 3 Place the transmission in neutral or park.
- 4 Install the wheel chocks.

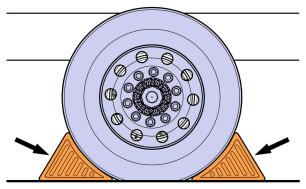

W7086748

- 5 Using Premium Tech Tool (PTT), run Accessory kit 85143650.
- 6 Reprogram the Vehicle Electronic Control Unit (VECU) MID 144.
- 7 Verify proper operation after reprogramming is complete.
- 8 Remove the wheel chocks.

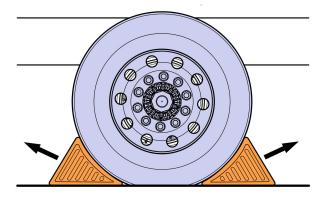

W7086759

## Reimbursement

This repair may be eligible for reimbursement if a product failure was experienced within time and mileage limits of the applicable Warranty coverage. Reimbursement is obtained via the normal claim handling process.	UCHP Reimbursement	eWarranty Reimbursement	
Claim Type (used only when uploading from the Dealer Bus. Sys.)	01	01	
Labor Code			
Primary Labor Code (Vehicle Electronic Control Unit (VECU), Reprogramming)	3646-22-09-02 0.6 hrs.	2303S-01-80 0.6 hrs.	
Causal Part	82280755	82280755	

MACK Trucks North America reserves the right to make any changes in design or to make additions to or upon its products without incurring any obligations to install the same on vehicles previously built.