

Technical Service Bulletin Number
--

TSB130042



Technical Service Bulletin

Subject

Inactive Fault Codes May Be Present After a Calibration Download and the Malfunction Indicator Lamp (MIL) May Be Illuminated.

Issue

This document describes an issue where inactive fault codes are present in the engine control module (ECM) after a calibration download. The MIL may also be illuminated.

Verification

Product Affected:

- ISB6.7 CM2350 B101
- ISB6.7 CM 2350 B103
- ISB4.5 CM2350 B104
- B6.7 CM2350 B121B
- ISL9 CM2350 L101
- ISX12 CM2350 X102
- ISX15 CM2350 X101

Inactive fault codes are present in the ECM after a calibration download.

The MIL is illuminated after a calibration download and there are no active fault codes.

Resolution

If inactive fault codes are present in the ECM and/or the MIL is illuminated after a calibration download, use the "Reset All Faults" command in INSITE™ electronic service tool and power-

down the ECM for 70 seconds.

NOTE: The “Reset Inactive Faults” command in INSITE™ electronic service tool can not be used on On-Board Diagnostics products.

Troubleshoot any remaining active fault codes in the ECM after performing the “Reset All Faults” command in INSITE™ electronic service tool and the 70 second power-down has been performed.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Document History

Date	Details
2013-2-13	Module Created
2013-2-15	QSOL Quick Fix Reason: Hyperlink Error Notes: none
2013-10-28	Update the engine model list to show the latest Euro engine launch
2016-9-21	Added B6.7 CM2350 B121B.

Last Modified: 23-Sep-2016

Copyright © 2000-2010 Cummins Inc. All rights reserved.