

March 22, 2016

03180 Version 1

MIL Come On with DTC P100C and P0010

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2014–15	Accord Hybrid	ALL	ALL
2014	Accord Plug-IN	ALL	ALL

SYMPTOM

The MIL comes on with DTC P100C (electric VTC motor speed signal circuit malfunction) and P0010 (VTC malfunction).

POSSIBLE CAUSES

The VTC control software generates a false detection on DTC P100C and P0010.

CORRECTIVE ACTION

Update the PGM-FI software.

SOFTWARE INFORMATION

NOTE: Unnecessary or incorrect repairs resulting from a failure to update the HDS or MVCI are not covered under warranty.

MVCI Control Module (CM) Update:

Application Version **3.01.50 or later**

Database update **03-Mar-2016 or later**

HDS Software Version:

3.018.013 or later

Before beginning the repair, make sure that both the HDS and MVCI are updated as listed above.

Do only the update listed in this service bulletin.

Check that the MVCI indicates the applicable program ID listed below (or a later program ID) as the **Available Update** when the update begins.

If the MVCI displays **This vehicle does not need an update at this time** during the update, the software for this bulletin is already installed.

For more information about updating the HDS, the MVCI, and vehicle systems, refer to Service Bulletin 01-023, *Updating Control Units/Modules*.

Year/Model	Program ID (or later)	Program P/N (or later)
2014–15 Accord Hybrid	K1A570	37805-5K1-A57
2014–15 Accord Hybrid (Touring with ACC)	K1A670	37805-5K1-A67
2014 Accord Plug-IN	K0A130	37805-5K0-A13

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
1255D8	Update the PGM-FI software.	0.2 hr	03214	03203	16-014A	37805-5K1-A56

Skill Level: Repair Technician

REPAIR PROCEDURE

Update the PGM-FI control unit software. Refer to Service Bulletin 01-023, *Updating Control Units/Modules*.

END