

Technical Service Bulletin Number
--

TSB140169



Technical Service Bulletin

Subject

Fuel Lift Pump Obsolete and Superseded on ISX and QSX Engines

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

ISX15 CM2250

ISX15 CM2250 SN

ISX15 CM2350 X101

QSX15 CM2250 ECF

PowerGen QSX15 CM2250

PowerGen QSX15 CM2250 ECF

ISX12/ISX11.9 CM2250

ISX12 CM2350 X102

QSX11.9 CM2250 ECF

Reason for Change

To address instances of fault code 2265, Electric Lift Pump for Engine Fuel Supply Circuit - Voltage Above Normal or Shorted to High Source, due to open circuits in the fuel lift pump.

Service Directions

Perform troubleshooting as published in the corresponding Fault Code Troubleshooting Manual, before replacing the electric lift pump.

Service Parts Availability

Service parts became available on 15 December 2014. See Table 1 for part numbers.

Part Description	Voltage	Obsolete Part Number	New Part Number
Fuel lift pump	12 V	3686718	3690768
Fuel lift pump	24 V	3686719	3691145

Part Structure

The part is backward compatible and transparent to assembly.

The existing fuel lift pump part numbers have been obsoleted and superseded by the new fuel lift pump part numbers.

Part Disposition

Use existing part number inventory before using the new part number.

Production Status

The implementation date for production has **not** been determined.

Publications Affected

None.

Document History

Date	Details
2014-12-1	Module Created

Last Modified: 19-Jan-2015

Copyright © 2000-2010 Cummins Inc. All rights reserved.