

### **Technical Service Bulletin**

	GROUP	NUMBER		
8 8	CAMPAIGN	16-01-072		
	DATE	MODEL(S)		
	DECEMBER 2016	VELOSTER (FS)		

SUBJECT:

TAILGATE SWITCH REPLACEMENT (SERVICE CAMPAIGN T10)

#### \* IMPORTANT

#### \*\*\* Dealer Stock and Retail Vehicles \*\*\*

Dealers must perform this Service Campaign on all affected vehicles prior to customer retail delivery and whenever an affected vehicle is in the shop for any maintenance or repair.

When a vehicle arrives at the service department, access Hyundai Motor America's "warranty vehicle information" screen via WEBDCS to identify open campaigns.

**Description:** On certain 2015-16MY Veloster (FS) the tailgate handle may not function properly due to an internal issue with the tailgate switch. This condition may affect the tailgate open and closing functionality.

This bulletin describes the procedure to replace the tailgate switch for the Veloster (FS).





Applicable Vehicles: Certain 2015-16 Veloster (FS)

#### PARTS INFORMATION:

PART IMAGE	PART NUMBER	DESCRIPTION
	81260-2V010QQH	TAILGATE SWITCH



Wear protective goggles and gloves for protection when performing the procedures in this bulletin.

### **WARRANTY INFORMATION:**

MODEL	OPCODE	OPERATION	OPTIME	CASUAL PART	NATURE CODE	CAUSE CODE
Veloster (FS)	60C036R0	TAILGATE SWITCH REPLACEMENT	0.4 <b>M/H</b>	81260-2 <b>V</b> 010	l11	ZZ3

NOTE: Submit Claim on Campaign Claim Entry Screen

#### SERVICE PROCEDURE


Open the tailgate (A).




TSB #: 16-01-072 Page 2 of 6

2. To remove the tailgate trim panel (B), remove the tailgate center trim (B1) and tailgate side trim (B2) by gently pulling on the panel to disengage the panel clips.

Note: Yellow circle indicates clip locations.

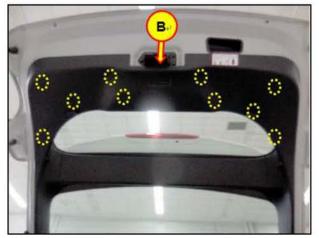

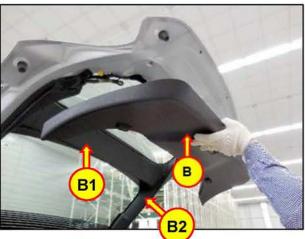


 Disconnect the tailgate outside handle connector (C).




TSB #: 16-01-072 Page 3 of 6

4. Remove the tailgate outside handle nuts (D).


Tightening torque: 1.9~ 2.9 Nm (0.2 ~ 0.3 kgf.m, 1.4 ~ 2.1 lb-ft)

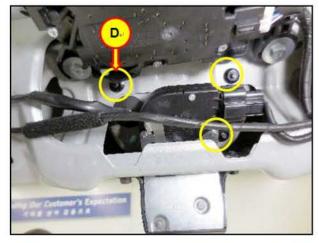

5. Unlock the tailgate outside handle locking clips (E).

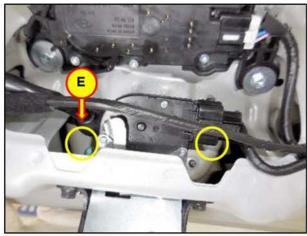


6. Remove the tailgate outside handle assembly (F).

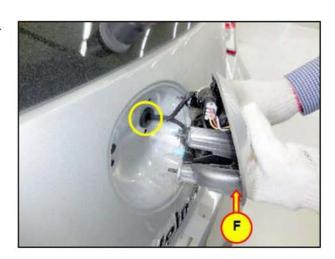


TSB #: 16-01-072 Page 4 of 6


7. Disconnect the tailgate switch connector (G).

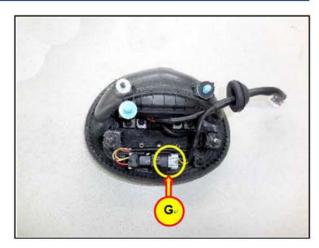

8. Remove the tailgate switch screws (H).

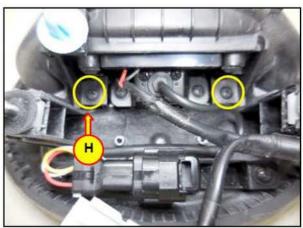


9. Remove the switch assembly (J) from the outside handle (I).

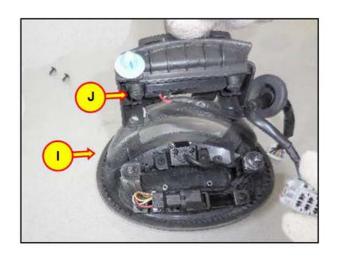

TSB #: 16-01-072 Page 5 of 6

10. Remove the clip (K) in the red arrow direction on the switch assembly (J).

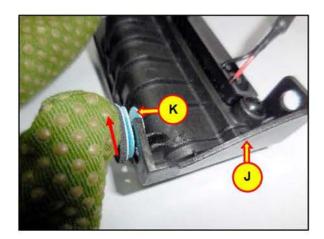


11. Reuse the clip (K) for the new switch assembly (J).

Install the new switch assembly (J) to the outside handle.

Reinstall all the removed parts in reverse order of removal.

Operate the tailgate by opening and closing a few times to ensure proper operation. Ensure proper operation of the backup camera.

Service procedure is now complete.

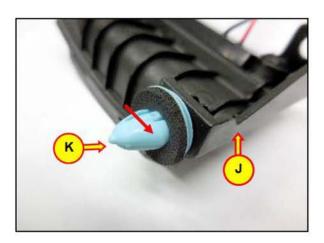

TSB #: 16-01-072 Page 6 of 6