



Technical Service Bulletin

19 Coolant pipe seepage on turbocharger

19 16 76 2036167/5 December 6, 2016. Supersedes Technical Service Bulletin Group 19 number 16-75 dated October 19, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8, S6, S7, S8, RS 7	2013 - 2017	All	4.0 T

Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised header data (Added multiple vehicles and model years)
4	10/19/2016	Revised <i>Service</i> (Removed S6/S7 MY13 SVM code)
3	10/04/2016	Revised <i>Required Parts and Tools</i> (Updated part numbers) Revised <i>Service</i> (Added SVM code) Revised header data (Added model year and removed VIN break)

Customer concern states one of the following conditions:

- The low coolant level light is illuminated
- The coolant level is too low
- A black crust is visible on the turbocharger coolant lines

Technical Service Bulletin

Technical Background

There may be slow coolant loss from the connections at the coolant feed pipe and the coolant return pipe. High temperatures cause the coolant to become encrusted on the connection flange of the turbocharger (Figure 1).

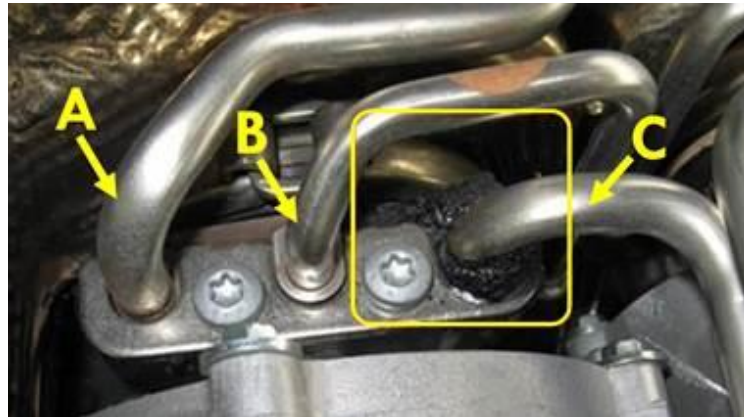


Figure 1. Black, encrusted coolant residue (outlined area), coolant feed pipe (A), oil feed pipe (B), and coolant return pipe (C).

The resulting heat after switching off the engine can, under special operating conditions, lead to very high temperatures on the coolant seals of the turbocharger. This can damage the O-ring.

Production Solution

Optimized temperature-resistant O-rings on the coolant connection of the turbocharger together with an extended operating period of the auxiliary cooling pump after switching off the engine.

Technical Service Bulletin

Service

Replace the respective O-rings on the coolant supply and return pipes according to the table listed below:

Coolant line position	Part number of coolant pipe	Part number of optimized O-ring	Size of O-ring / thickness
Cylinder bank 2, supply	079145909F Original pipe	WHT006335A	2.0 mm (blue)
Cylinder bank 1, supply	079145910F Original pipe	WHT006335A	2.0 mm (blue)
Cylinder bank 2, return	079145947E Original pipe	WHT006335A	2,0 mm (blue)
Cylinder bank 1, return	079145948F Original pipe	WHT006335A	2.0 mm (blue)
Cylinder bank 2, supply	079145909H Replacement pipe	WHT006537	2.8 mm (black)
Cylinder bank 1, supply	079145910H Replacement pipe	WHT006537	2.8 mm (black)
Cylinder bank 2, return	079145947G Replacement pipe	WHT006537	2.8 mm (black)
Cylinder bank 1, return	079145948H Replacement pipe	WHT006537	2.8 mm (black)

! **Note:** The O-ring assignment can be based on one part number on the coolant pipes, as there is no mixed installation allowed. The original coolant pipes had a 2.5 mm O-ring groove which require the 2.0 mm (blue) O-rings. The later/replacement coolant pipes had larger 3.5 mm groove which require the 2.8 mm (black) O-rings. Special tool 3371 can be used to measure the thickness of the O-ring groove to determine the correct O-ring fitment. Replacing the coolant pipes is not allowed!

For the replacement of the two O-rings for the coolant supply pipes we recommend the following pipe position to allow access to remove and replace the O-rings (Figure 2).

Technical Service Bulletin



Figure 2. Recommended pipe position.

1. Clean the intake ports for the coolant pipes on the top of the turbochargers, the ports should be clean and dry before installing the coolant pipes with the O-rings. The new O-rings are coated with a lubricating agent and should be installed dry.
2. Replace the oil feed pipe O-rings. Coat lightly with clean engine oil, do not allow engine oil to touch the coolant O-rings.
3. Install the pipe retaining plate and secure loosely, attach pipe retainer brackets and torque retaining plate bolts to 9 nm and reassemble intake pipes and hoses.
4. Fill the new coolant additive in the cooling system according to manufacturer guidelines. Observe the mixture ratio and filling-up procedure.
5. Only mix distilled water with coolant additives. Distilled water provides optimum corrosion protection.



Technical Service Bulletin

6. The filling procedure outlined in ElsaPro must be followed. It is important that the vacuum-down, filling and bleeding processes for the specific vehicle being repaired are used.
7. New software in the Engine Control Module (J623) (address word 0001) addressed the condition.
8. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
9. Update the Engine Control module (J623) (address word 0001) using the SVM action code as listed in the table below if necessary:

Model	Engine	Old Software Part Number	Old Software Version (or lower)	New Software Part Number	New Software Version (or higher)	SVM Code Input
S6/S6 MY13	4.0TFSI	4G0906014B	0008	4G0906014B	0009	01A225
S6/S6 MY13	CEUC	4G0906014	0011	4G0906014	0012	01A225
S6/S6 MY13	CEUC	4G0906014A	0007	4G0906014A	0008	01A225
S6/S6 MY14	4.0TFSI	4G0906014E	0008	4G0906014E	0006	01A225
S6/S6 MY15	4.0TFSI	4G0906014E	0008	4G0906014E	0006	01A225
S6/S6 MY16	4.0TFSI	4G0906014C	0005	4G0906014C	0006	01A225
S6/S6 MY16	4.0TFSI	4G0906014D	0001	4G0906014D	0002	01A225
RS 7 MY14	4.0TFSI	4G0906560A	0005	4G0906560A	0006	01A225
RS 7 MY14	4.0TFSI	4G0906560	0011	4G0906560	0012	01A225
RS 7 MY14	4.0TFSI	4G0906560B	0007	4G0906560B	0008	01A225
RS 7 MY15-16	4.0TFSI	4G0906560F	0002	4G0906560F	0003	01A225
RS 7 MY16 Performance	4.0TFSI	4G0906560G	0001	4G0906560G	0002	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014	0007	4H0906014	0008	01A225



Technical Service Bulletin

A8 4.0TFSI MY13-14	4.0TFSI	4H0906014A	0005	4H0906014A	0006	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014B	0004	4H0906014L	0005	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014C	0004	4H0906014C	0005	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014D	0004	4H0906014D	0005	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014H	0005	4H0906014H	0006	01A225
A8 4.0TFSI MY13-14	4.0TFSI	4H0906014L	0004	4H0906014L	0005	01A225
A8 4.0TFSI MY15	4.0TFSI	4H0906014G	0007	4H0906014G	0008	01A225
A8 4.0TFSI MY15	4.0TFSI	4H0906014J	0005	4H0906014J	0006	01A225
A8 4.0TFSI MY15	4.0TFSI	4H0906014K	0004	4H0906014K	0005	01A225
A8 Sport MY16	4.0TFSI	4H0906014N	0001	4H0906014N	0002	01A225
S8 MY13	4.0TFSI	4H0907557B	0004	4H0907557E	0004	01A225
S8 MY14	4.0TFSI	4H0907557E	0003	4H0907557E	0004	01A225
S8 MY15-16	4.0TFSI	4H0907557C	0005	4H0907557C	0006	01A225
S8 MY15-16	4.0TFSI	4H0907557D	0005	4H0907557D	0006	01A225
S8 Plus MY16	4.0TFSI	4H0907557G	0003	4H0907557G	0004	01A225
S8 Plus MY16	4.0TFSI	4H0907557H	0001	4H0907557H	0002	01A225

10. Check the software version number of the engine control unit:



Technical Service Bulletin

- Software version included in table: update the engine control unit with **SVM code 01A225**.
- Software version not included in table: already optimized or not available, only replace the O-rings.

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	1961		
Damage Code:	0050		
Labor Operations:	Coolant pipes O-rings and oil feed pipe O-rings (Includes drain and fill cooling system.)	1961 5299	140 TU
	Check software level in ECM only (with no update needed)	2470 0199	Max 10 TU
	Check software level in ECM and perform update	2470 2599	Max 50 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2036167/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

Part Number	Part Description	Quantity
N 91056801	Upper oil feed pipe O-ring 12 x 2 mm	2
WHT006335A	O-ring coolant supply and return 2.0 mm (blue) order depending on lines installed on vehicle.	4
WHT006537	O-ring coolant supply and return 2.8 mm (black) order depending on lines installed on vehicle.	4
WHT005529	Intake pipe O-rings	2
G 013A8J1G	Coolant additive	1
Outside material	Distilled water (obtain locally)	As needed (Max \$10.00)

Tool Number	Tool Description
3371	Gauge – Gap Adjustment Tool
V.A.G 1274/8	Adapter
V.A.G 1274/10	Adapter
VAS 6096	Cooling system charge unit
T10007 A	Refractometer
	Approved Battery Charger

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 00 *Software Version Management (SVM), operating instructions.*

All parts and service references provided in this TSB (2036167) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.



Technical Service Bulletin

©2016 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.