

---

<b>Reference</b>	SSM72581
<b>Models</b>	XJ / X351
<b>Title</b>	X351 XJ Centre Console Cup Holder Cover Split
<b>Category</b>	Body
<b>Last modified</b>	07-Jul-2016 00:00:00
<b>Symptom</b>	107000 Interior Trim
<b>Attachments</b>	1Cup Holder Cover.jpg (1Cup Holder Cover.jpg)

---

**Content****Applicable VIN Range****V00325 - V93401****J76001 - J76583****Issue**

Centre Console Cup Holder Cover Split (See attachment)

**Cause**

Insufficient retention between cup holder cover bars and substrate material. Mechanical fixings (plugs) to the leading handle bar and substrate have been added to improve the bond from VIN No.V93401.

**Action**

Ensure that there are no other factors that have caused the cup holder to fail, for example spilled drinks that have contaminated the sliding mechanism causing it to stick. The only repair option is to replace the cup holder.

**JLR engineering would like to thank everyone who submitted EPQR's contributing to this investigation.**

**Please only submit further reports for vehicles that are NOT within the above VIN range.**

