

© 2016 Mazda Motor of America, Inc.

Subject: FRONT SEAT RECLINER LEVER KNOB DIFFICULT TO USE	Bulletin No: 09-032/16
	Last Issued: 05/13/2016

APPLICABLE MODEL(S)/VINS


2016 CX-3 vehicles with VINs lower than JM1 DK ***** 136420 (produced before March 01, 2016)

2016 Mazda2

DESCRIPTION

Some customers may complain about a front seat recliner lever knob difficult to move. This makes it difficult to change the seat back reclining position.

This may be caused by a return recliner lever knob spring (A) that is too strong.

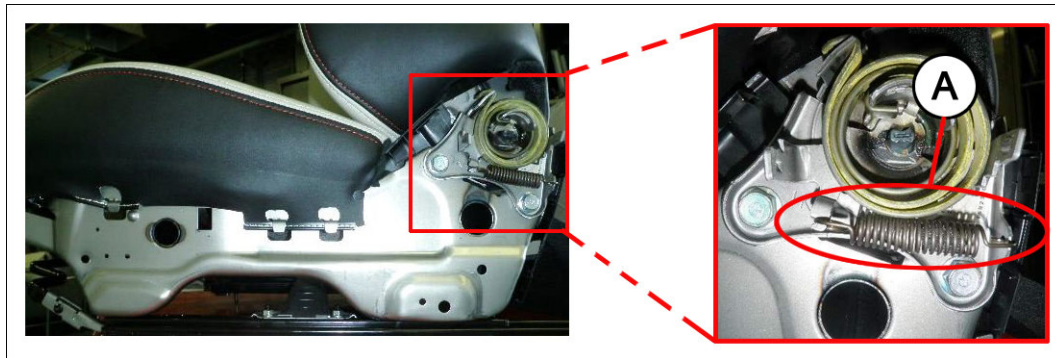


Front seat (Driver side)

Customers having this concern should have their vehicle repaired using the following repair procedure.


CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

REPAIR PROCEDURE

1. Verify customer concern.
2. Remove the front seat side cover (door side) (E).
 - a. Remove seat height adjustment lever (B) by pulling on the inner release tab (C), then slide the lever forward to remove.
 - b. Remove seat recline lever (D) by pulling outward. Discard the seat recline lever.
 - c. Remove seat side cover (E) by pulling outward.

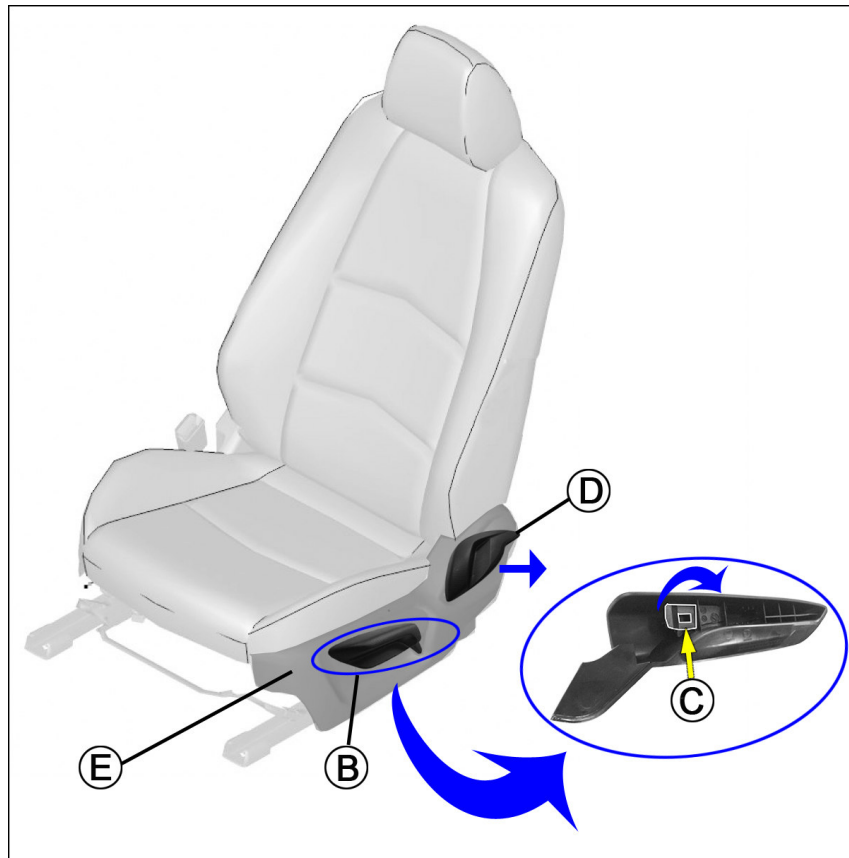

3. Remove the return spring (A) and install a new one.

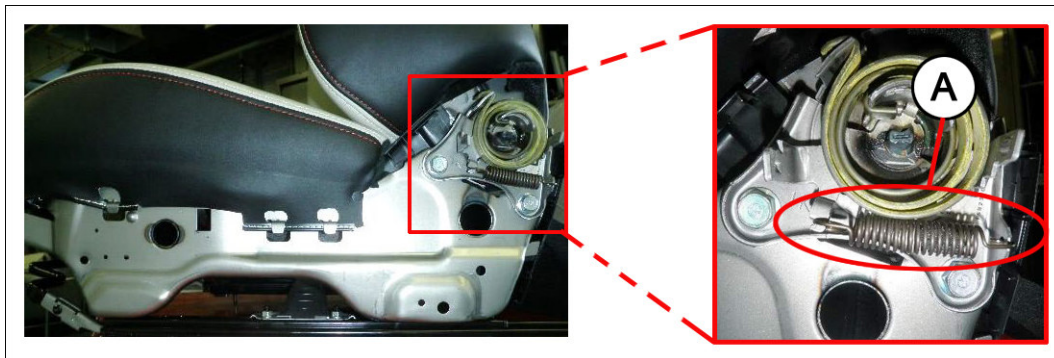

4. Install the front seat side cover (E) with 2 new clips, seat height adjustment lever (B) and the new recliner lever (D).
5. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
D0YT-57-X5X	LEVER ASSY, RH	1	Right side. Parts set includes one return spring and the recliner lever knob.
D0YT-57-X5Y	LEVER ASSY, LH	1	Left side. Parts set includes one return spring and the recliner lever knob.
BBY4-88-072	CLIP	2 or 4	One side requires 2 clips.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- This TSB can be performed by D329 Mazda Certified Lube Technicians.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	72
Damage Code	9C
Part Number Main Cause	D0YT-57-X5X or D0YT-57-X5Y
Quantity	1
Operation Number / Labor Hours:	XXM1DARX / 0.3 Hrs. One side XXM1DBRX / 0.4 Hrs. Both sides
This TSB can be performed by D329 Mazda Certified Lube Technicians:	Yes

NOTE: When the spring is replaced for both sides, claim the other side as a related part number.