

TECHNICAL BULLETIN

JTB00523NAS1
04 OCT 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-05

Luggage Compartment Lid Latch Cover Detached

AFFECTED VEHICLE RANGE:

XE (X760)

Model Year: 2017 Onwards
VIN: 921222 Onwards
Assembly Plant: Solihull

XE (X760)

Model Year: 2017 Onwards
VIN: P00001 Onwards
Assembly Plant: Castle Bromwich

XF (X260)

Model Year: 2017 Onwards
VIN: Y05001 Onwards
Assembly Plant: Castle Bromwich

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The luggage compartment lid latch cover may become detached.

Cause: This may be caused by the carpet on the luggage compartment lid holding off the latch cover and preventing the clips from fully latching.

Action: Should a Customer express concern, follow the Service Instruction below.

PARTS:

T2H2192	Latch Cover	1
---------	-------------	---

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Luggage compartment lid - Latch cover - Modification - XE (X760)	76.20.32	0.1	12	T2H2192

Luggage compartment lid - Latch cover - Modification - XF (X260)	76.20.32	0.1	12	T2H2192
---	-----------------	-----	----	---------



NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION:

1. Open the luggage compartment lid.
2. Remove the luggage compartment lid bump stops (where applicable).



E197232


3. Remove the two fasteners.



4. Remove and discard the luggage compartment lid latch cover.




5. Pull the luggage compartment lid carpet trim down as shown and visually check that the latch assembly clipping features are intact and not damaged.

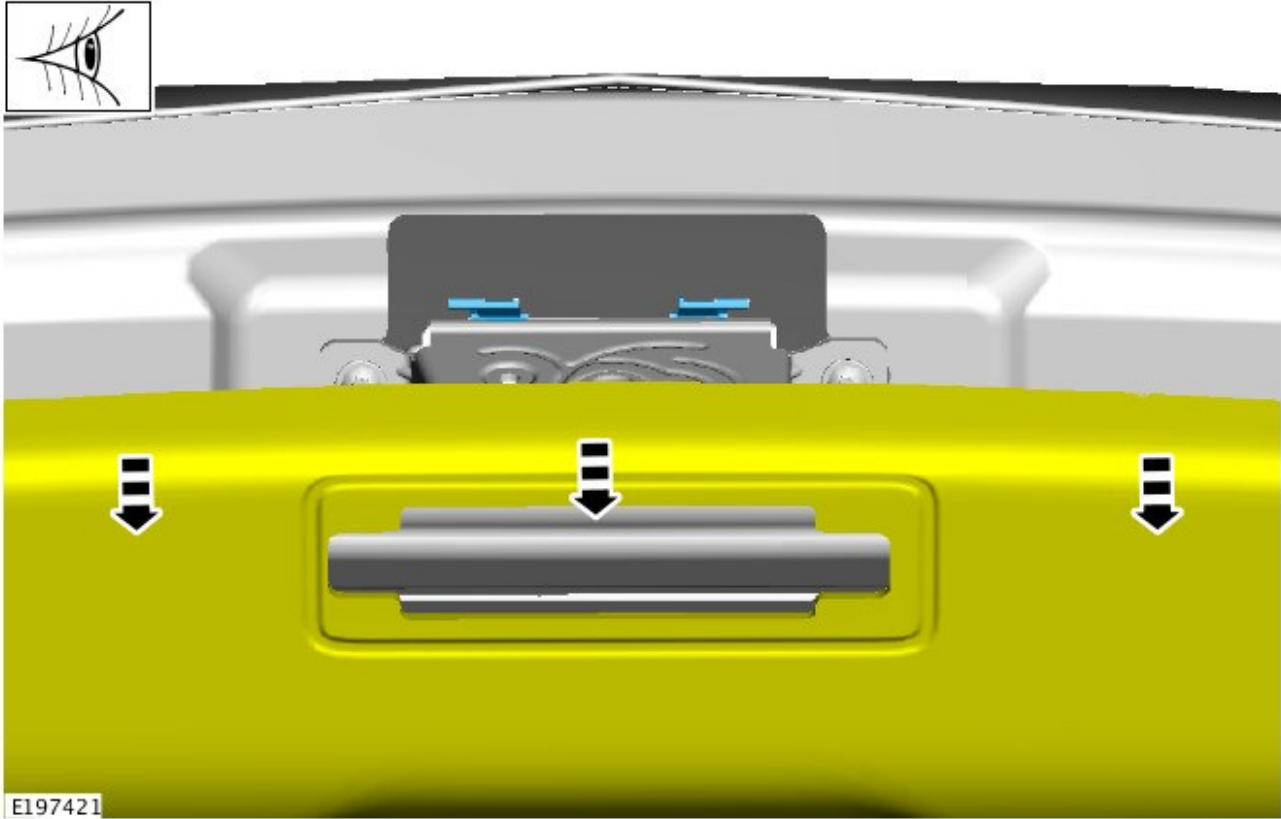

6.  **NOTE: Working on the luggage compartment lid carpet trim and starting from one end of the area shown.**

Push in at (1) while bending the top edge (2) towards you to flatten any high points on the return edge.

- Work along the area shown.

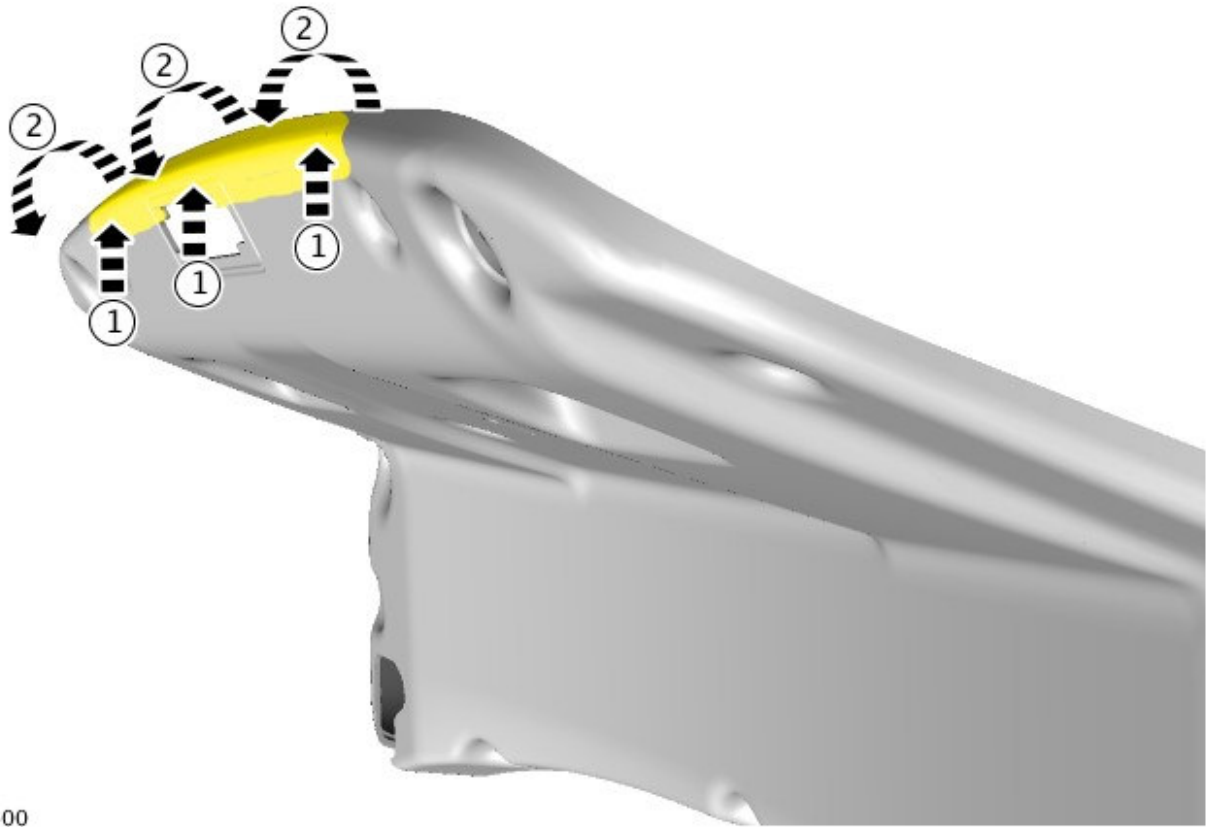

E197400


7.  **NOTE: Make sure to not bend the legs too far.**

Bend the legs on the new luggage compartment lid latch cover in the direction shown by approximately 10 degrees.



E197237

8. Install the new luggage compartment lid latch cover by pushing with the palm of your hand on the center of the latch cover until an audible click noise is heard.
 - Push again, once on each side of the latch at points **A** and **B** to check both clips have latched correctly.

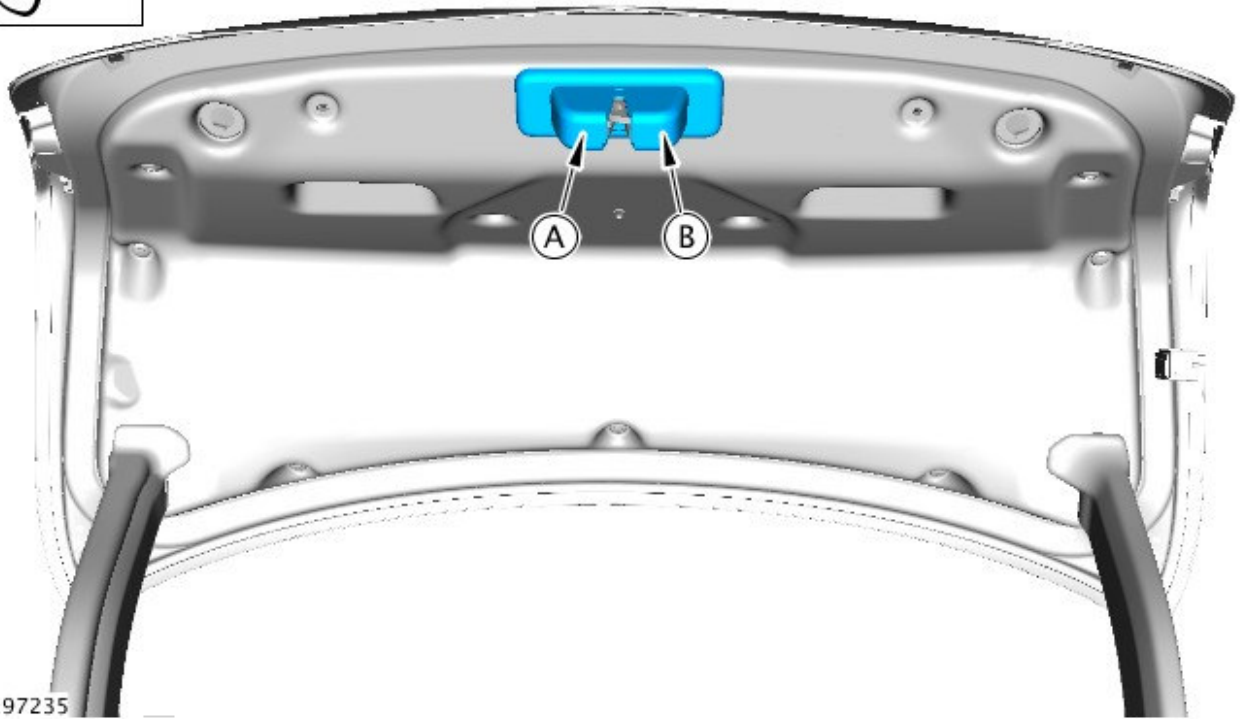

E197235

9. Pull the luggage compartment lid down by pulling on the luggage compartment lid latch cover to confirm the integrity of the installation.

- If the luggage compartment lid latch cover becomes detached at this stage, repeat Steps 6-8.



E197236

10. Install the two fasteners.



E197233

11. Install the luggage compartment lid bump stops (where applicable).



12. Close the luggage compartment lid.