

<b>Reference</b>	SSM73019
<b>Models</b>	F-PACE / X761 XE / X760 XF / X260
<b>Title</b>	Lane Keep Assist and Lane Departure Warning features not operating correctly
<b>Category</b>	Electrical
<b>Last modified</b>	19-Oct-2016 00:00:00
<b>Symptom</b>	206000 Warning Indicators
<b>Content</b>	<p><b><u>Issue</u></b> The Image Processing Module A (IPMA module, Forward Looking Camera) is being changed unnecessarily and to aid in correctly diagnosing customer issues related to the Lane Keep Assist(LKA) and Lane Departure Warning(LDW) features. The customer is complaining about LKA and LDW issues, for example, not available, not working, not disengaging when the indicator stalk is engaged.</p> <p><b><u>Cause</u></b> Module software not to the latest level</p> <p><b><u>Action</u></b> Using SDD</p> <p>Update the GWM software to the latest version available.</p> <p>Re - Configure the Image Processing Module A (IPMA) as a <b><u>New</u></b> module</p> <p>Run IPMA Calibration with SDD</p> <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p> <p>3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.</p> <p>5 = Excellent – All required information provided to resolve the customer concern.</p>

