
Reference	SSM72581
Models	XJ / X351
Title	X351 XJ Centre Console Cup Holder Cover Split
Category	Body
Last modified	08-Jan-2016 00:00:00
Symptom	107000 Interior Trim
Attachments	Cup Holder Cover.jpg (Cup Holder Cover.jpg)

Content**Applicable VIN Range****V00325 - V93401****Issue**

Centre Console Cup Holder Cover Split (See attachment)

Cause

Insufficient retention between cup holder cover bars and substrate material. Mechanical fixings (plugs) to the leading handle bar and substrate have been added to improve the bond from VIN No.V93401.

Action

Ensure that there are no other factors that have caused the cup holder to fail, for example spilled drinks that have contaminated the sliding mechanism causing it to stick. The only repair option is to replace the cup holder.

JLR engineering would like to thank everyone who submitted EPQR's contributing to this investigation.

Please only submit further reports for vehicles that are NOT within the above VIN range.

