

Reference	SSM72591
Models	F-TYPE / X152 XE / X760 XF / X250 XF / X260 XJ / X351
Title	Loss of navigation GPS signal.
Category	Electrical
Last modified	14-Jan-2016 00:00:00
Symptom	207000 Entertainment Systems
Content	<p><u>Vehicles affected</u> F Type (X152) - All Vehicles XJ(X351) – All vehicles up to 16MY, Vin number V90865 XF(X250) - 15MY vehicles only XE(X760) - All Vehicles New XF(X260) - All Vehicles</p> <p><u>Issue.</u> GPS antenna is being replaced and is no fault found when tested by supplier</p> <p><u>Gen2.1 systems fitted to XJ and XF</u> Current car position indicator will not lock onto correct location on map. Navigation will display 'GPS' icon when in Navigation split screen. This indicates GPS not available.</p> <p><u>In Control Touch fitted to XE and new XF</u> Current car position indicator will not lock onto correct location on map. From the main menu select Information -Where am I - GPS. The current location will be given.</p> <p>Note: When testing the GPS a signal may not be detected inside buildings. This isn't an error state, hence it is important to verify functionality outside in open space.</p> <p><u>Cause</u> Incorrect diagnosis</p> <p><u>Action</u> Carry out vehicle hard reset. If 'GPS strike through' icon disappears (Gen 2.1) or current location is found (In Control Touch) then no further action is required.</p> <p>If the GPS is still inoperative then continue to use SDD and reference Topix workshop</p>

manual for further diagnostics guidance