

Reference	SSM72946
Models	Discovery Sport / L550 Range Rover Evoque / L538
Title	L550 & L538 9HP48 9-Speed with P2545-86 and/or P2546-86 DTC's stored
Category	Driveline
Last modified	01-Sep-2016 00:00:00
Symptom	501000 Automatic Transmission Concerns
Content	<p>Concern: Discovery Sport (LC) 2015 & 2016MY & Range Rover Evoque (LV) 2014MY onwards fitted with 9HP48 9-Speed Automatic Transmission: retailers reporting these vehicles are flagging the following (TCM) Transmission control module DTC's P2545-86 and/or P2546-86 codes during SDD DTC read or on customer concern Should there be other transmission related fault codes in addition these other codes should be investigated and resolved before proceeding with this instruction.</p> <p>Issue: Transmission control module (TCM's) are been replaced under warranty and on investigation on returned parts have found with no fault found</p> <p>Action: Any retailer seeing this DTC P2545-86 and/or P2546-86 firstly check the transmission for any oil leaks and repair as required if no oil leaks are evident check the oil level, and repair as required then Update the TCM software where an update is available, then clear the DTC and if the DTC does not re-log no further action required return to customer If the DTC is repeatable then provide the original session file and the latest session file showing the DTC detail and raise a Fixed Right Enhanced Diagnostics (FRED) for transmission replacement approval</p>