

TECHNICAL BULLETIN
JTB00461NAS1
06 JUN 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-12

Sunglasses Holder Inoperative

AFFECTED VEHICLE RANGE:

F-PACE (X761)

Model Year: 2017 Onwards
VIN: 045409 Onwards
Assembly Plant: Solihull

XE (X760)

Model Year: 2017 Onwards
VIN: 942528 Onwards
Assembly Plant: Solihull

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The front overhead console sunglasses holder may appear to be distorted and will not latch correctly in certain conditions.

Cause: This may be caused by hinge pin distortion, allowing the cam mechanism to be displaced and become inoperative.

Action: Should a customer express this concern, follow the Service Instruction below.

PARTS:

T2H23526LKP	Sunglasses Holder - Oyster	1
T2H23526PVJ	Sunglasses Holder - Ebony	1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Sunglasses holder - Renew	76.13.23	0.2	07	T2H 21029 LKP

 **NOTE: Normal Warranty procedures apply.**

COMPONENT LOCATION

1.  **NOTE: XE (X760) shown; F-PACE (X761) similar.**


Component location.

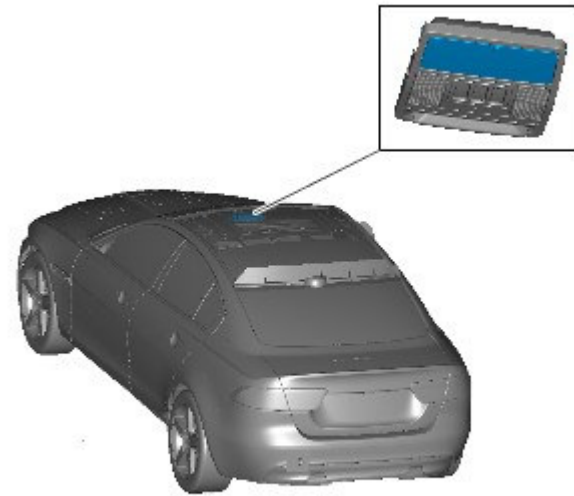

E184931


SERVICE INSTRUCTION:

1. Remove the overhead console (see TOPIx Workshop Manual, section 501-12: Instrument Panel and Console)
2. Hold the rear cover and push the sunglasses holder cover in the direction shown.
 - Lift up to release the two rear retaining clips.
 - Push the outboard retaining clip tower in direction shown and then the sunglasses holder cover can lift upwards away from the metal retaining clip.
 - Repeat for the other side and remove the sunglasses holder cover from the front overhead console.

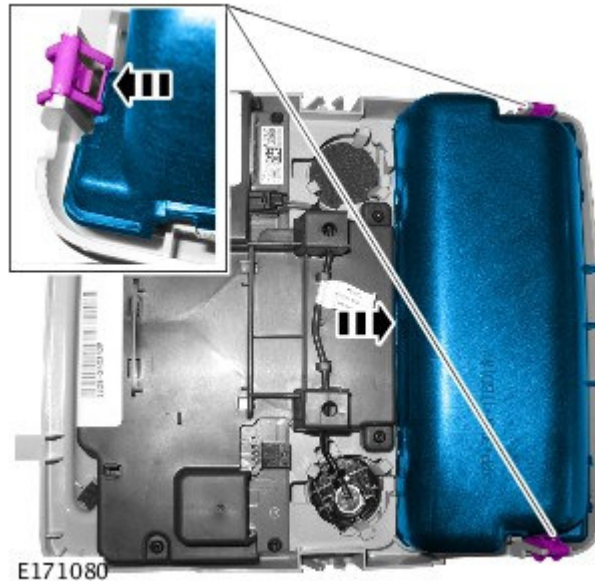

E171080


3. Remove and discard the retaining screw on the side of the sunglasses holder.

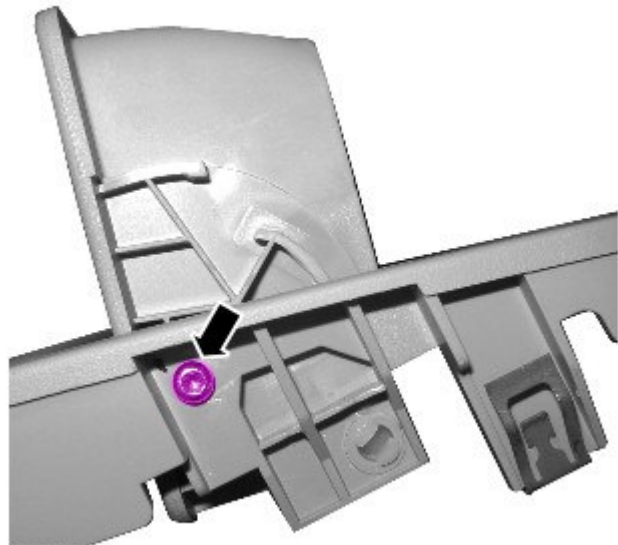

E171083

4. Remove and discard the sunglasses holder.

- Remove the pin near to the damper.
- Remove the pin on the other side of sunglasses holder door

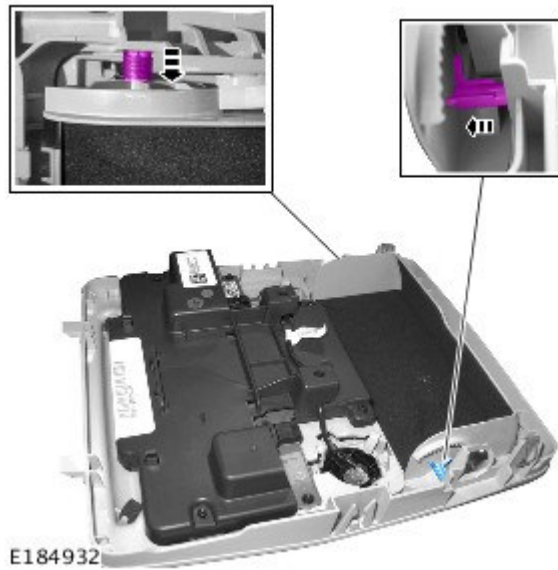

E184932


5.  **NOTE: Use Nyogel® 774L or equivalent (from the Squeaks & Rattles Kit; refer to Technical Bulletin JTB00231NAS).**

Apply Nyogel® 774L (or equivalent) into the hinge pin holes.



6.  **NOTE: Make sure the spring is positioned correctly.**

Install the new sunglasses holder.

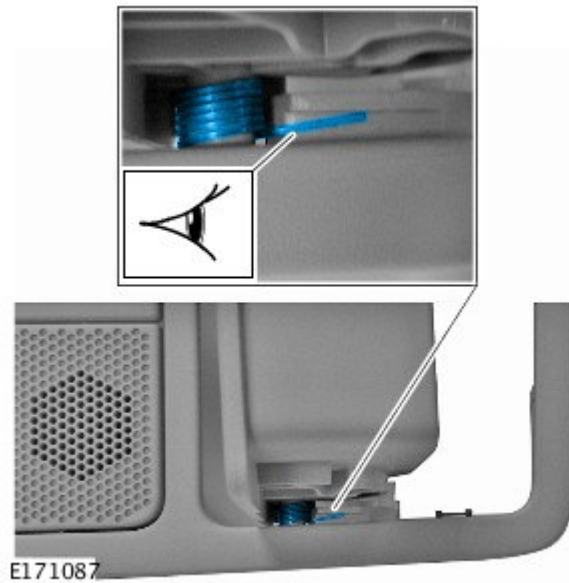

7. Operate the sunglasses holder three times to check correct functionality.
8. Install the sunglasses holder cover.
9. Install the front overhead console (see TOPIX Workshop Manual, section 501-12: Instrument Panel and Console).