

Reference	SSM72824
Models	F-TYPE / X152 XF / X250 XJ / X351
Title	USB inteface inoperative due to the use of an incorrectl specification device
Category	Electrical
Last modified	15-Jun-2016 00:00:00
Symptom	207000 Entertainment Systems
Content	<p><u>Note</u> <u>Only applicable to Infotainment Gen 2.1 systems.</u></p> <p><u>Vehicles affected</u> F Type (X152) all models XF (X250) to end of production. X351 (X351) to end of 15my</p> <p>Issue Customers are unable to charge accessories or play music using the USB port on Gen 2.1 infotainment system.</p> <p>Cause DTC B1252-19 Has been triggered by the over draw of current through the USB port which disables the User Interface Panel (UIP) until the next Ignition cycle and the accessory that is causing the over draw is removed.</p> <p>Action Due to the use of devices which exceed the specific requirements outlined in the owner's manual the UIP has caused a temporary shutdown to protect both the users interface and the vehicle wiring system from further damage. There is NO reason to replace the UIP in question as an engine recycle will recover the UIP and allow connectivity of interfaces that are recognised as applicable through the USB connection. Should and engine recycle NOT recover the UIP and allow connectivity then further investigation is required but it is not advised to connect appliances to this until the fault has been rectified.</p>