

Subject: BRAKE FLUID SEEPAGE FROM BRAKE MASTER CYLINDER RESERVE TANK CAP	Bulletin No: 04-001/15
	Last Issued: 07/09/2015

APPLICABLE MODEL(S)/VINS

2007-2015 CX-9

DESCRIPTION

Some vehicles may exhibit brake fluid seepage from the brake master cylinder reserve tank cap. The upper surface of the reserve tank may appear dusty or dirty where the brake fluid seepage has occurred.

This concern may be caused by a decrease in sealing performance of cap due to aging deterioration. A new cap with improved sealing performance has been established as a service part.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify the customer concern.
2. Wipe off all the brake fluid, dirt and debris from the brake master cylinder reserve tank.
3. Remove existing cap.
4. Install a new service part cap.
5. Verify the repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
TDY2-43-55Y	Cap	1	---

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.
- This TSB can be performed by D329 Mazda Certified Lube Technicians.

Warranty Type	A
Symptom Code	98
Damage Code	91
Part Number Main Cause	TDY2-43-55Y
Quantity	1
Operation Number / Labor Hours:	XXL4CXRX / 0.2 Hrs.
TSB can be performed by D329 Mazda Certified Lube Technicians:	Yes