
Reference	SSM71999
Models	Range Rover / L405 Range Rover Sport / L494
Title	Adaptive cruise does not operate, front number plates fitted incorrectly.
Category	Electrical
Last modified	24-Sep-2014 00:00:00
Symptom	206000 Warning Indicators
Attachments	

Content**Issue**

The adaptive cruise function does not operate. The instrument pack will show a yellow warning triangle and the message "radar sensor blocked" Also on interrogation of the module the following code would be logged C1A67-97, "forward looking sensor obstructed or blocked".

Cause

The radar is located below the front number plate plinth on these models. If the incorrect size number plate or multiple number plates are fitted this can obstruct the radar.

Action

Before proceeding with any diagnosis ensure that the number plate(s) is fitted correctly and is the correct size.