

Reference	SSM72164
Models	Discovery Sport / L550 Range Rover Evoque / L538
Title	P0795, P07E3, P0893, P07E0, P1758 DTC.
Category	Driveline
Last modified	17-Aug-2015 00:00:00
Symptom	504000 Other Automatic Transmission Concerns
Content	<p><u>Issue:</u> A small volume of 14 and 15 model year (MY) Evoque (L538) and 15MY Discovery sport (L550) vehicles are flagging the following DTC codes, which all relate to the 9HP48 automatic transmission:</p> <ul style="list-style-type: none">• P0795-04• P07E3-07• P0893-07• P07E0-07• P1758-62 <p><u>Cause:</u> DTC flagging due to a TCM software error and/or engine torque issue.</p> <p><u>Action:</u> Update the Transmission Control Module (TCM) software to the latest available version. Once updated: Re-test the vehicles. Note: If a specific road test is required it will be listed in TOPIX (section 100-00) Diagnostic Trouble Code (DTC) Index DTC: Transmission Control Module (TCM) against the appropriate DTC.</p> <ul style="list-style-type: none">• If the DTC does not occur again release to customer.• If DTC is captured again, please follow standard diagnosis procedures and refer to TOPIX instructions including engine checks if required.