



Technical Service Bulletin

91 Audi connect is not functioning and the message "Please wait.." continually appears

91 18 01 2042942/2 June 20, 2018. Supersedes Technical Service Bulletin Group 91 number 16-27 dated January 26, 2016 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
All	2016 - 2017	All	With Audi connect

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (Added models) Revised <i>Service</i> (Added Note)
1	01/26/2016	Initial publication

Customer states:

- The Audi connect Gen 2 system does not function.
- The message "Please wait..." continually appears (Figure 1).
- The system might only receive a 3G cellular connection in areas with strong 4G LTE reception.



Figure 1. "Please wait..." message.

Technical Background

It is possible that the Audi connect configuration is incorrect due to a communication issue with the backend server in Germany. A full factory reset of the MMI system is required to fix the incorrect configuration, as a factory reset of only the Audi connect settings may not correct the issue.

Production Solution

Not applicable.



Technical Service Bulletin

Service

Perform a full factory reset of the MMI system using the following instructions.

! Note:

This process will clear all customer configurations in the MMI system.

1. In the MMI settings, select “Factory settings”, then “Select all entries” (Figure 2).

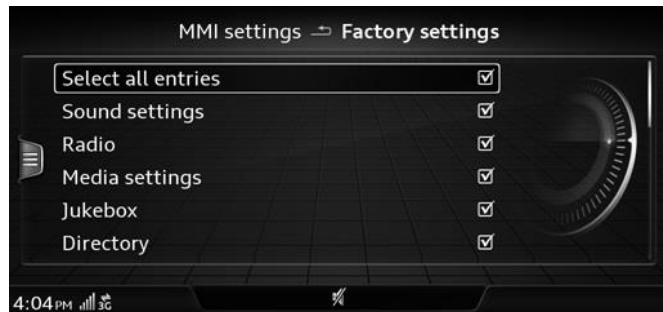


Figure 2. Choose “Select all entries”.

2. Next, select “Restore factory settings” (Figure 3).

The MMI screen will retract after about 10-15 seconds, then the system will take 1-2 minutes to fully reset.

After the reset, the screen will open. If the screen fails to open after two minutes, press down on the volume knob to force the system to power on.

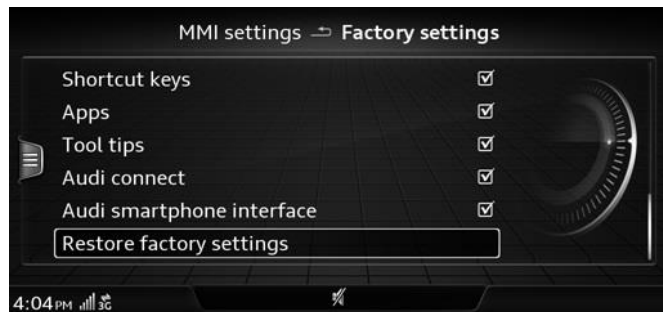


Figure 3. Select “Restore factory settings”.

3. After the system is able to receive a full LTE connection (showing data arrows on top of the LTE symbol), navigate to and select Audi connect. In some cases, the LTE icon may not show after a full factory reset, but the MMI system is able to retrieve data from Audi connect. If this condition occurs, allow the vehicle to go through an ignition sleep cycle (turn ignition off, close all windows, lock car, and allow it to sit for two minutes, and then turn ignition back on).
4. Allow the system to retrieve new licenses from the backend server. It can take up to 60 seconds for the Audi connect information (weather, fuel, price, traffic, and etc.) to fully load.
5. Confirm that the issue is resolved. If the issue persists, contact the Audi connect customer/dealer service center at 1-888-545-9434.

When contacting the support center, have the following three pieces of information ready:

- **Vehicle VIN**



Technical Service Bulletin

- **ICCID number** (Also known as the SIM card serial number of the 5F-Information control module 1. The ICCID is located in an MVB labeled “Internal SIM card identification”. The ICCID is a 20-digit number that begins with “8901170”).
- **IMEI number** (Also known as the telephone serial number of the 5F-Information control module 1. The IMEI is located in an MVB labeled “Telephone serial number”. The IMEI is a 15-digit number that begins with “3549140”).

If the Audi connect support center is unable to help, contact TAC.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2042942) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2018 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.