



Preliminary Information

PIT5825B Vibration Type Noise Heard at Highway Speeds or with Engine Speed at 1,300-1,500 RPM


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT5	2020 - 2021	All	ALL	LGX	All
Cadillac	XT6	2020 - 2021	All	ALL	LGX	All
Chevrolet	Blazer	2020 - 2021	All	ALL	LGX	All
GMC	Acadia	2020 - 2021	All	ALL	LGX	All

Involved Region or Country	North America
Condition	Vibration type noise at highway speeds or with Engine Speed at 1,300-1,500 RPM heard under the vehicle.
Cause	Some of the metal gasket tabs between the front exhaust and muffler are not fully crimped, exhibiting some spring-back, allowing for them to touch at certain speeds / RPMs.

Correction:

With a small punch or chisel and hammer bend/crimp the tabs on the exhaust gasket in further to prevent any spring-back and provide increased clearance between the two tabs to correct the noise or cutting the tabs off the gaskets is also acceptable.

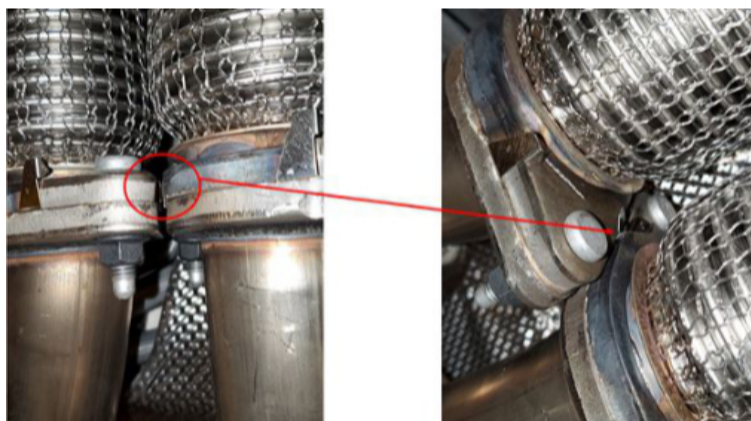

Parts Information

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4050272	Exhaust System Alignment	0.3 Hrs.

Version History

Version	2
Modified	03/16/2021 - Created on. 03/30/2021 - Updated to add RPO LGX 04/06/2021 Updated to add Engine Speed at 1,300-1,500 RPM cutting the tabs off the gaskets is also acceptable



GENERAL MOTORS