

Service Bulletin

Bulletin No.: 21-NA-184

Date: August, 2021

TECHNICAL

Subject: Window Regulator – Replace Power Window Regulator Electronics

This Service Bulletin replaces PIT5922. Please discard all previous copies of PIT5922.

| Brand: | Model: | Model Year: | | Build Date: | | Engine: | Transmission: |
|--------|----------|-------------|------|-------------|----|---------|---------------|
| Біапи. | woder. | from | to | from | to | | |
| GMC | Yukon | 2021 | 2023 | _ | _ | _ | |
| | Yukon XL | 2021 | | | | | _ |

| Involved Region or Country | North America | | |
|----------------------------|--|--|--|
| Additional Options (RPOs) | | | |
| Condition | Some customers may have had new window regulator electronics or window motor installed and will need the up-to-date calibrations for the Body Control Module (BCM). The correct cal files are based on the build date of the vehicles. Note: Replacement parts may involve BCM reprogramming as well as window motor replacement. | | |
| Cause | The cause of the condition may be that due to part shortages with the Brose FD window regulators, engineering developed and implemented Continental electronics to be used that need to be re-calibrated. | | |
| | Verify the vehicle build date for proper window electronics and cal files: | | |
| | Important: Calibration file part numbers change every model year | | |
| | Model Year 2021 Vehicles | | |
| | 2021 Vehicles with RPO &00W Continental Window Regulators will need to be replaced with Brose electronics and a new calibration file | | |
| | Both Regulator Assemblies/Motors need to be replaced | | |
| | Model Year 2022 Vehicles | | |
| | 2022 Vehicles with RPOs &00X Bosch and &00W Continental Window Regulators will need to be replaced with Brose electronics and a new calibration | | |
| | Both Regulator Assemblies/ Motors need to be replaced | | |
| Correction | 2022 Vehicles with RPO —00X Brose is compatible with the standard service motor, does not need to replaced and uses the factory calibration | | |
| | Do NOT need to replace both doors | | |
| | Model Year 2023 Vehicles | | |
| | 2023 Vehicles with RPO &00X Bosch Window Regulators will be replaced with Brose electronics and a new calibration | | |
| | Both Regulator Assemblies/ Motors need to be replaced | | |
| | 2023 Vehicles with RPO —00X Brose Window Regulators are compatible with the standard service motor and calibration file. | | |
| | Do NOT need to replace both doors | | |
| | Note: If the incorrect cal files are downloaded, then technician may find DTC B1956 "Window Motor not configured" set current or in recent history. | | |

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.


Caution: Before downloading the update files, be sure the computer is connected to the internet through a network cable (hardwired). DO NOT DOWNLOAD or install the files wirelessly. If there is an interruption during programming, programming failure or control module damage may occur.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to www.gmdesolutions.com for further information. If not available, connect a fully charged 12V jumper or booster pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Follow the on-screen prompts regarding ignition power mode, but ensure that anything that drains excessive power (exterior lights, HVAC blower motor, etc) is off.
- Please verify that the radio time and date are set correctly before inserting USB drive into vehicle for programming, otherwise an error will result.
- Clear DTCs after programming is complete.
 Clearing powertrain DTCs will set the Inspection/ Maintenance (I/M) system status indicators to NO.

Important: The service technician always needs to verify that the VIN displayed in the TLC left side drop down menu and the top center window match the VIN plate of the vehicle to be programmed prior to using Service Programming System 2 (SPS2) for programming or reprogramming a module.

- For the TLC application, service technicians need to always ensure that the power mode (ignition) is "ON" before reading the VIN from the vehicle's VIN master module and that they do not select a VIN that is already in the TLC application memory from a previous vehicle.
- If the VIN that shows up in the TLC top center window after correctly reading the VIN from the vehicle does not match the VIN plate of the vehicle, manually type in the VIN characters from the vehicle VIN plate into the TLC top center window and use these for programming or reprogramming the subject module with the correct vehicle VIN and software and/or calibrations.
- The Engine Control Module (ECM) is the master module (for VIP vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the ECM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.
- The Body Control Module (BCM) is the master module (for GEM vehicles) that TLC reads to determine the VIN of the vehicle. If the VIN read from the vehicle by TLC does not match the VIN plate of the vehicle, the BCM also needs to be reprogrammed with the correct VIN, software and calibrations that match the vehicle's VIN plate.

Caution: Be sure the VIN selected in the drop down menu (1) is the same as the vehicle connected (2) before beginning programming.

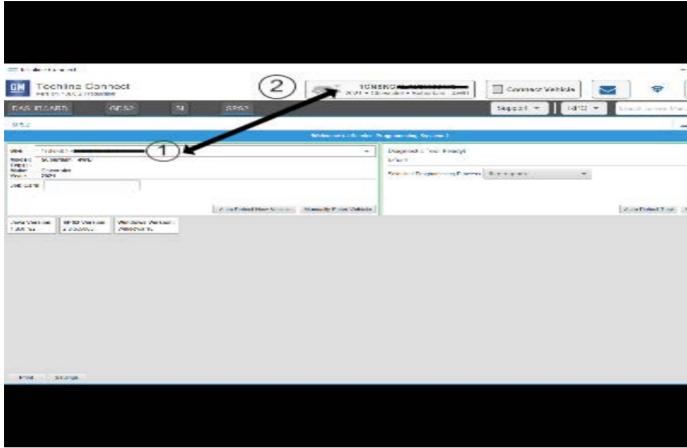


5743643

Important: If the vehicle VIN DOES NOT match, the message below will be shown.



5877000

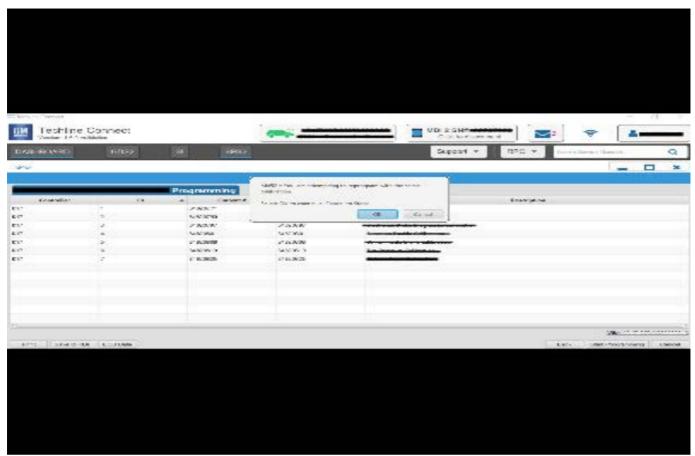


5644477

Important: Techline Connect and TIS2WEB screens shown above.

Important: If the same calibration/software warning is noted on the TLC or SPS Summary screen, select OK and follow screen instructions. After a successful programming event, the WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty Information section of this bulletin.

1. Verify the build date of the vehicle for the correct cal files then reprogram the Body Control Module. Refer to K9 Body Control Module: Programming and Setup in SI.

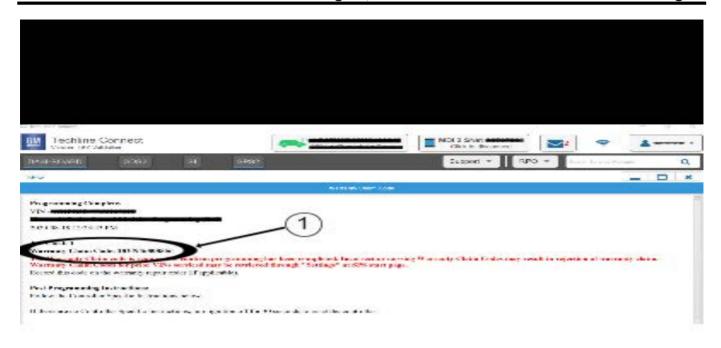



5644478

Note: The screenshots above are an example of module programming and may not be indicative of the specific module that is being programmed. Module selection and VIN information have been blacked out.

Important: To avoid warranty transaction rejections, you **MUST** record the warranty claim code provided on the SPS Warranty Claim Code (WCC) screen shown above on the job card. Refer to callout 1 above for the location of the WCC on the SPS screen.

2. Record the SPS Warranty Claim Code on the job card for warranty transaction submission.

Parts Information

| Causal Part | Description | Front Door | RPO | Part Number | Calibration File | Qty | | |
|-------------|--|--------------------------|--------------------------|--|--|----------|----------|---|
| | Brose Window | LH | | 86791280 | 84951244 | 1 | | |
| Х | Regulator Electronics for 2021 Model Year | &AEF RH &AXG | 86791279 | (Chevy, GMC) 85112189 (Cadillac) | 1 | | | |
| | Continental | LH | | 85543164 | | 1 | | |
| X | Window Regulator Electronics for 2021 Model Year | RH | &00W | 85543165 | 85564266 | 1 | | |
| | Bosch Window | LH | | 85569746 | | 1 | | |
| | Regulator Electronics for 2022 | Electronics | lectronics RH 855 | 85569747 | 85569795 | 1 | | |
| | Continental | LH | | 85568144 | | 1 | | |
| Х | Window Regulator Electronics for 2022 | Regulator Electronics | Regulator Electronics | RH | &00W | 85568145 | 85564266 | 1 |
| | Brose Window Regulator Electronics for 2022 | LH | 00111 | 86791280 | 84951245 | 1 | | |
| ^ E | | ronics RH | -00W -00X | 86791279 | (Chevy, GMC) 85112194 (Cadillac) | 1 | | |
| | Bosch WIndow | LH | | 85569746 | | 1 | | |
| Χ | Regulator Electronics for 2023 | RH | &00X | 85569747 | 85637881 | 1 | | |
| | Brose Window | LH | | 86791280 | 84985418 | 1 | | |
| Х | Regulator Electronics for 2023 | RH | -00X | 86791279 | (Chevy, GMC) 84985419 (Cadillac) | 1 | | |

Warranty Information


For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|--|--|--|
| 2810215* | Body Control Module Reprogramming with SF | Use Published Labor Operation Time |
| | o avoid warranty transactions land follow the instructions l | |
| | | |
| | | |
| Labour Time [Top] | | |
| Labour Time [199] Labour Operation Code: Additional labour op code i | | arranty Claim Gode: |

6125814

- The Warranty Claim Code must be accurately entered in the "Warranty Claim Code" field of the transaction.
- When more than one Warranty Claim Code is generated for a programming event, it is required to document all Warranty Claim Codes in the "Correction" field on the job card. Dealers must also enter one of the codes in the "Warranty Claim Code" field of the transaction, otherwise the transaction will reject. It is best practice to enter the FINAL code provided by SPS2.

Warranty Claim Code Information Retrieval

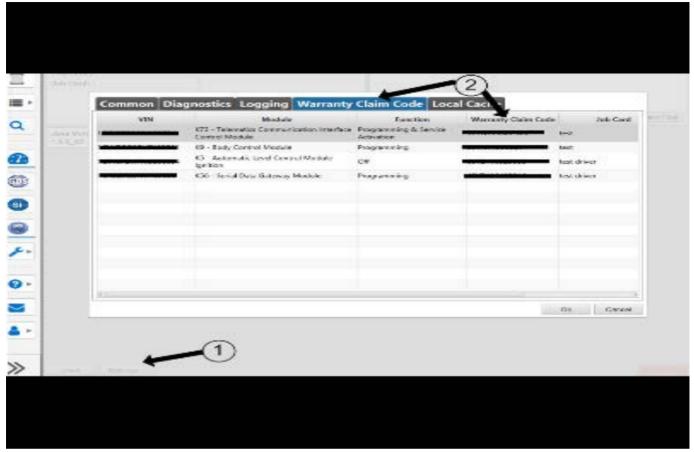

6125774

If the Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS2 system as follows:

- Open TLC on the computer used to program the vehicle.
- 2. Select and start SPS2.
- 3. Select Settings (1).
- 4. Select the Warranty Claim Code tab (2).

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

| Version | 2 |
|----------|--|
| Modified | Released August 12, 2021 Revised March 20, 2023 – Added PI, 2022 and 2023 Model Years, and correct Part Numbers and calibrations for Window Regulators |