

Technical Service Bulletin



40 Front shock absorber cap, cracking noises/spring jumps when steering or when maneuvering

40 23 59 2047758/10 June 6, 2023. Supersedes Technical Service Bulletin Group 40 number 23-57 dated May 24, 2023, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, and S3	2015 – 2020 2022 – 2023	All	Electronic Dampening
A3 Cabriolet	2015 – 2020		
TT, TTS, and TT Roadster	2016 - 2023		
A3 Sportback e-tron	2016 – 2018		
RS 3	2017 – 2020 2022 – 2023		
TT RS	2018 – 2022		
Q3	2019 - 2023		

Condition

REVISION HISTORY		
Revision	Date	Purpose
10	-	Revised <i>Required Parts and Tools</i> (Added Part Number)
9	05/24/2023	Revised <i>Required Parts and Tools</i> (Added Part Number)
8	07/09/2022	Revised header (Added Models and Model Years)

Customer states:

- Cracking noises/spring jumps when steering or when maneuvering.
- The noise can be reproduced when at least two people are in the vehicle and the steering wheel is turned just before the right/left stop.

Technical Background

The buffer stop for the shock absorber (Figure 1, 1) can cause noises if it touches the front shock absorber cap (Figure 1, 2).



Production Solution

Not Applicable

Service

Lightly lubricate the contact surface (red dotted line) between buffer stop for shock absorber (Figure 1, 1) and front shock absorber cap (Figure 1, 2) with 5 grams grease G 000 405 A2 per side.

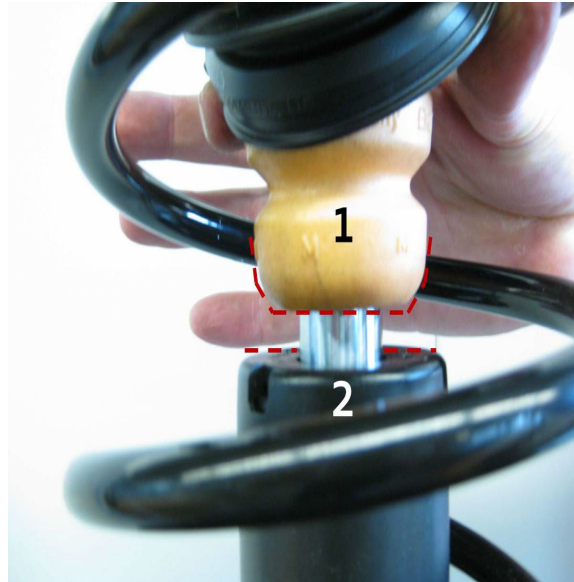


Figure 1. Shock absorber and buffer stop.



Tip: Check the protective sleeve of the front shock absorber for correct fit, they should turn easily in the axial deep-groove ball bearing/sleeve bearing.

Warranty

Claim Type:	<ul style="list-style-type: none"> 110 up to 48 Months/50,000 Miles. If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	4098		
Damage Code:	0020		
Labor Operations:	Lubricate both front rubber stops	4098 5099	30 TU
Diagnostic Time:	GFF	No allowance	0 TU

Technical Service Bulletin



	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB 2047758/10		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description	Quantity
G 000405A2 G 000405S0 (This number should be used in the SAGA warranty claim only)	Grease	1
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA

Additional Information

All parts and service references provided in this TSB (**2047758**) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.