



# Technical Service Bulletin

## 90 Traffic sign dependent speed limit setting default to "On" after ignition cycle

90 23 65 2072530/1 December 21, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2024	All	Not Applicable

## Condition

### Customer states:

- The Traffic sign dependent speed warning setting automatically reactivates every time the ignition is turned on (Figure 1).

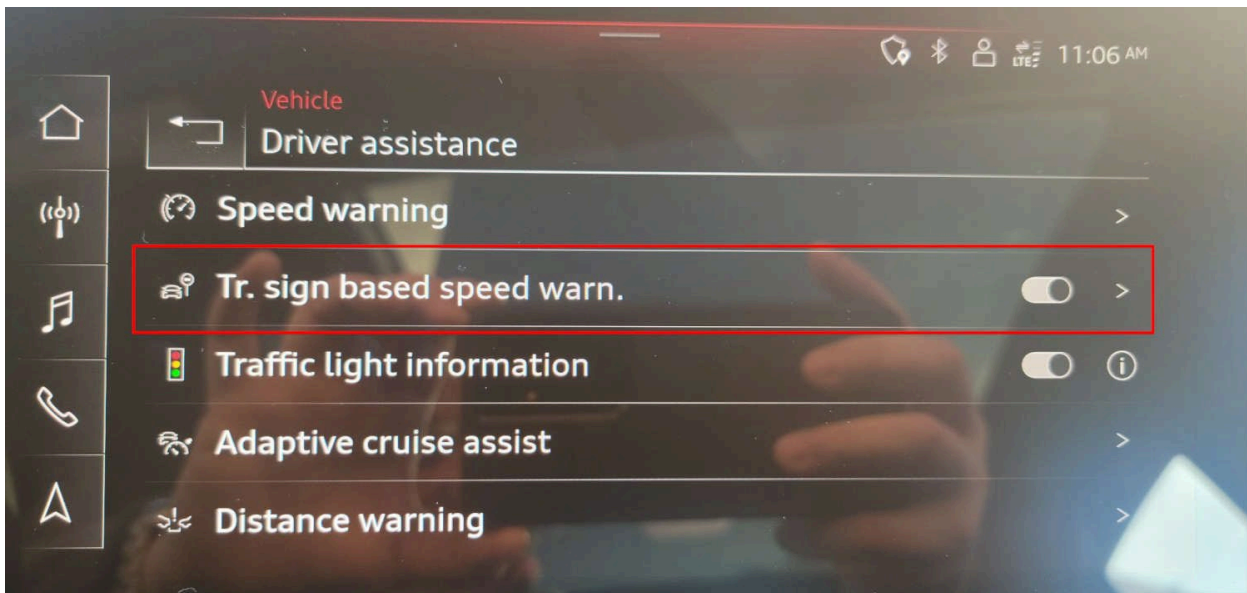


Figure 1: Traffic sign-based speed warning setting.

### Workshop findings:

- No Relevant DTCs are stored.

## Technical Background

Due to a new requirement in Europe, the traffic sign dependent speed limit setting is activated every time the ignition is turned on, regardless of its last setting. This is however not the intended functionality for other markets outside of Europe. A new ZDC is provided for those markets to revert to the previous, "last mode" functionality.

## Production Solution



# Technical Service Bulletin

New Target Data Container (ZDC) update in the driver assistant systems control module, J1121 (address word 00A5) addressed the condition.

## Service

1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
2. Update the Target Data Container in the driver assistant systems control module -J1121- (address word 00A5) using the SVM action code as listed in the table below, if necessary:

Model	Old Target Data Container Number	Old Target Data Container Version	New Target Data Container Number (or higher)	New Target Data Container Version (or higher)	SVM Code Input
e-tron GT, and RS e-tron GT	*	0001 - 0002	4J3909466BL	0003	<b>A5A019</b>

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"> <li>• 110 up to 48 Months/50,000 Miles.</li> <li>• G10 for CPO Covered Vehicles – Verify Owner.</li> <li>• If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
<b>Service Number:</b>	9093		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 50 TU)
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
<b>Claim Comment:</b>	As per TSB 2072530/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



# Technical Service Bulletin

---

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732: *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (**2072530**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.